


LOC/DME I-RIQ 111.1 Chan 48	APP CRS 214°	Rwy Ldg 13502 TDZE 3606 Apt Elev 3607
---	------------------------	--

LDA RWY 22
RICK HUSBAND AMARILLO INTL (AMA)

RADAR required for procedure entry. For inop ALS, increase LDA/GS-22 all Cats visibility to ¾ SM; increase LDA-22 Cat C/D/E visibility to ⅞ SM. Final approach course offset 4.45 degrees intersects the runway centerline 2509' from Rwy 22 thld. ASR			MALSR A5	MISSED APPROACH: Climbing left turn to 5000 on PNH VORTAC R-118 to CAUDE and hold.	
ATIS 118.85 350.3	AMARILLO APP CON★ 119.5 307.0	AMARILLO TOWER★ 118.3(CTAF) 257.9	GND CON 121.9 348.6	CLNC DEL 121.65 239.275	UNICOM 122.95

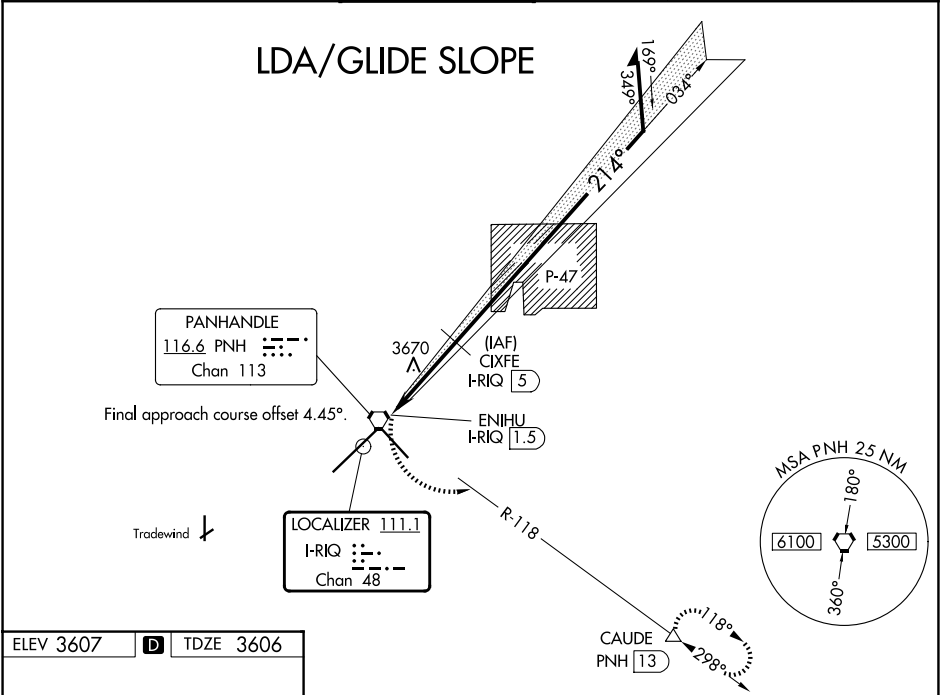

ELEV 3607	D	TDZE 3606
REIL Rwy 13 HIRL Rwy 4-22 and 13-31		
CATEGORY		
S-LDA/GS 22		
S-LDA 22		
CIRCLING		