


WAAS CH 78007 W33A	APP CRS 330°	Rwy Ldg 11440 TDZE 163 Apt Elev 192
--	------------------------	--


RNAV (GPS) RWY 33

BANGOR INTL (BGR)

RNP APCH:		MALSR	MISSED APPROACH:
Circling NA northeast of Rwy 15 and 33. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -18°C or above 54°C. For inop ALS, increase LPV Cat E visibility to RVR 4000, LNAV/VNAV Cat E visibility to RVR 5500, and LNAV Cat E visibility to 1¼ SM. **RVR 1800 authorized with use of FD or AP or HUD to DA.			Climb to 3000 direct IKEXE and hold.

ATIS 127.75	BANGOR APP CON 118.925 239.3	BANGOR TOWER 120.7 233.7	GND CON 121.9 348.6	CLNC DEL 135.9 348.6
-----------------------	--	------------------------------------	-------------------------------	--------------------------------

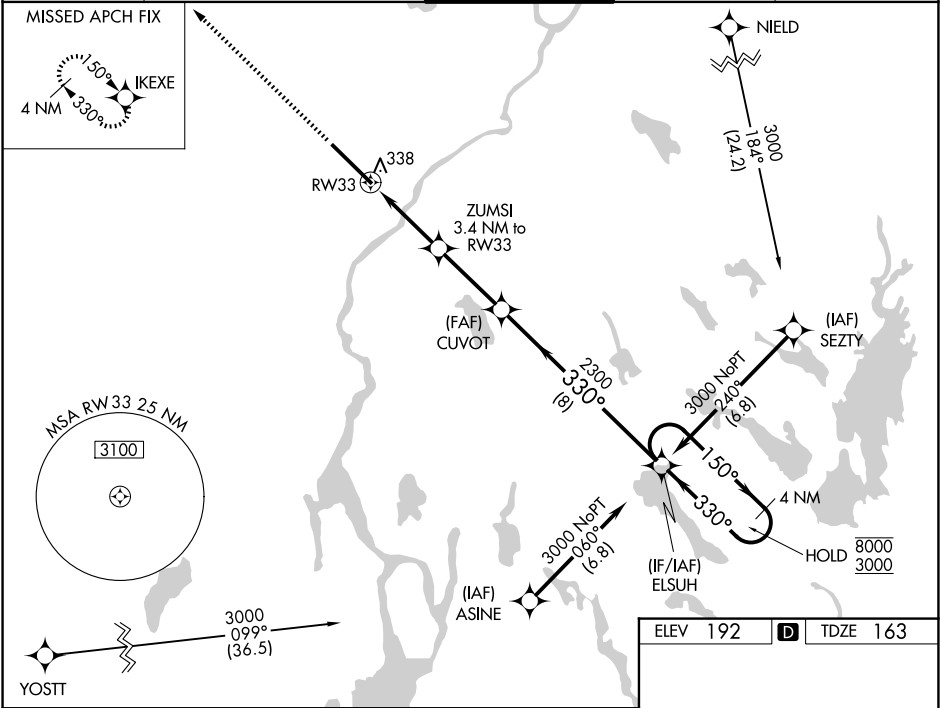

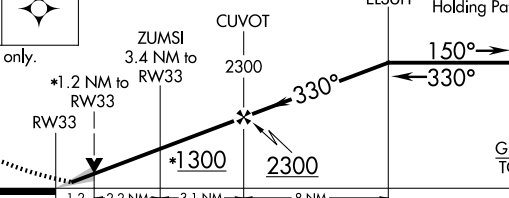3000	IKEXE					
*LNAV only.						
CATEGORY	A	B	C	D	E	
LPV DA**	363/24 200 (200-½)					
LNAV/VNAV DA	519/30 356 (400-¾)					
LNAV MDA	600/24	437 (500-½)	600/40	437 (500-¾)		
CIRCLING	640-1 448 (500-1)	720-1 528 (600-1)	740-1½ 548 (600-1½)	820-2 628 (700-2)	880-2½ 688 (700-2½)	

