

ILS RWY 5L (SA CAT I)
INDIANAPOLIS INTL (IND)

MISSED APPROACH: Climb to 1700 then climbing left turn to 3000 direct VHP VORTAC then on VHP VORTAC R-303 to KEADY/VHP 4.9 DME/RADAR and hold.

MISSED APCH FIX

← R-303
 123°
 303°
 116.3 VHP
 Chan 110

KEADY
 VHP **4.9**
 RADAR

OINKK INT
 I-IND **6.1**
 RADAR

STDUM
 I-IND **9**
 RADAR

(IF)
 FTBLL
 I-IND **12.1**
 RADAR

(IAF)
 WAAAYN
 I-IND **15.2**
 RADAR
 210K

5000 to WAAAYN
 004° (0.9) and
 LOC (10.1)

(IAF)
 KELLY
 VHP **27.9**

(CFVDC)

230°

2100
 050°
 (2.8)

3000
 050°
 (3.1)

400
 050°
 (3.1)

116.3 VHP
 R-183
 Chan 110

RADAR or DME REQUIRED

MSA VHP 25 NM
3100

LOCALIZER **111.75**
 I-IND
 Chan 54(Y)

IM
 870±

ALTERNATE MISSED
 APCH FIX


115.3 TTH
 R-077
 Chan 100

077°
 257°
 CLOTT
 TTH **23.3**
 RADAR

Procedure NA for arrivals at
 KELLY on V11 southwest bound
 and V12 westbound.


ELEV **796** **D** TDZE **747**

1700	3000	VHP 	VHP R-303	KEADY VHP 4.9 RADAR
------	------	--	--------------	---------------------------

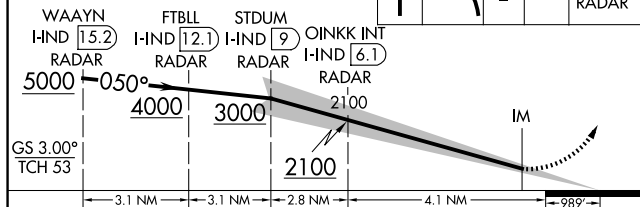

CATEGORY	A	B	C	D
S-ILS 5L	RA 178/14 150 DA 897			

SA CATEGORY I ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

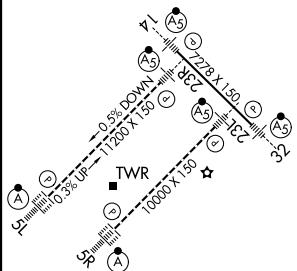

HIRL all Rwy's
TDZ/CL Rwy's 5L and 5R