

HI-TACAN Z RWY 16

|                      |                  |                                             |
|----------------------|------------------|---------------------------------------------|
| TACAN KSY<br>Chan 57 | APCH CRS<br>151° | Rwy Idg 11,550<br>TDZE 690<br>Arpt Elev 690 |
|----------------------|------------------|---------------------------------------------|

[USAF]


KELLY FLD (KSKF)

▼ \* When ALS inop, increase RVR to 60 and vis to 1½ miles.  
\*\* Circling not authorized E of Rwy 16-34.




MISSED APPROACH: Climb to 2500 via KSY TACAN R-163 until 4 DME, then continue climb to 3000 to FITER/15 DME and hold.

|                      |                                     |                       |                        |
|----------------------|-------------------------------------|-----------------------|------------------------|
| ATIS<br>120.45 273.5 | SAN ANTONIO APP CON<br>118.05 353.5 | TOWER<br>124.3 322.35 | GND CON<br>121.8 289.4 |
|----------------------|-------------------------------------|-----------------------|------------------------|

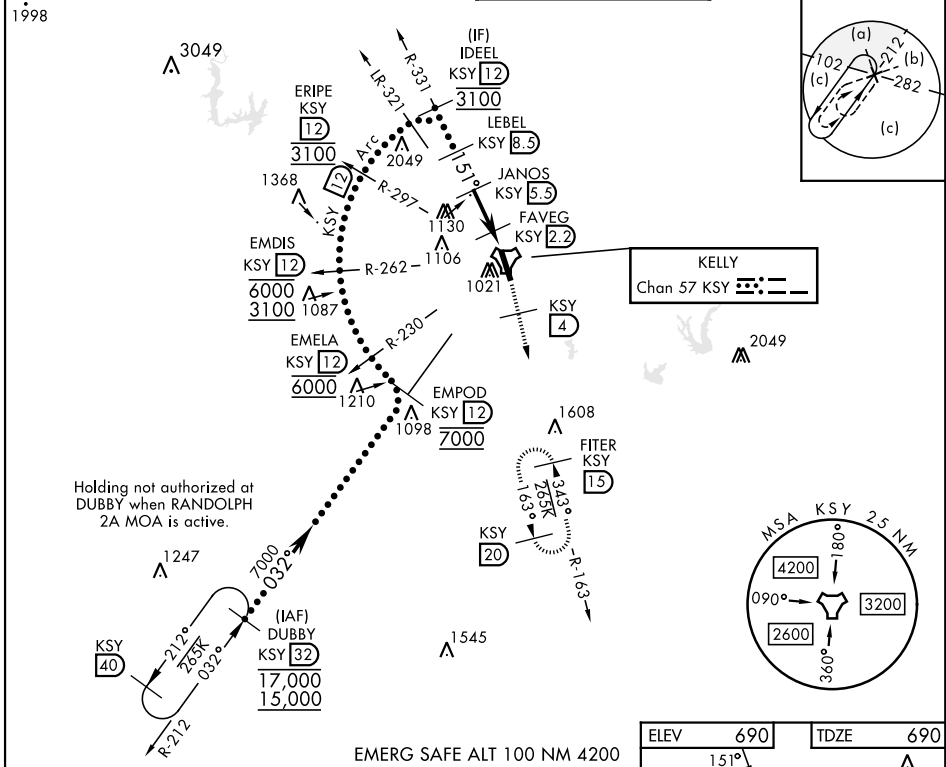

|                                                                        |  |  |  |                      |          |                            |
|------------------------------------------------------------------------|--|--|--|----------------------|----------|----------------------------|
| VGSI and descent angles<br>not coincident (VGSI<br>angle 3.01/TCH 89). |  |  |  | 2500<br>KSY<br>R-163 | KSY<br>4 | 3000<br>FITER<br>KSY<br>15 |
|                                                                        |  |  |  |                      |          |                            |

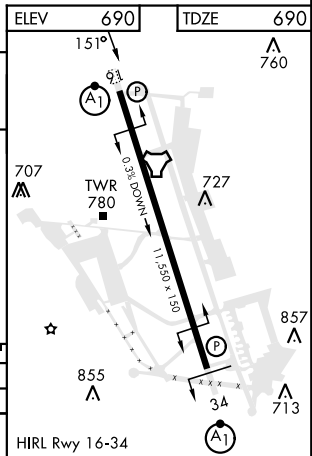

HI-TACAN Z RWY 16