
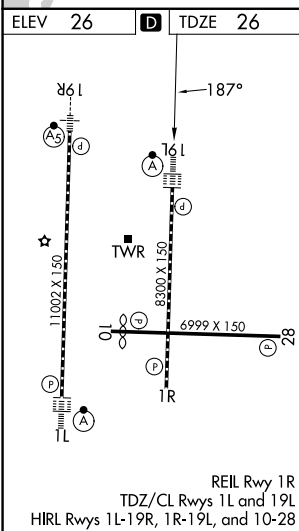




WAAS CH 49100 W19A	APP CRS 187°	Rwy Ldg TDZE 26 Apt Elev 26
--	------------------------	---

RNAV (GPS) RWY 19L
TAMPA INTL (TPA)

RNP APCH - GPS.			ALSIF-2	MISSED APPROACH: Climb to 2000 direct CUPUL and on track 147° to GIBBS and hold.
▼ LNAV procedure NA during simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 4°C or above 54°C. Simultaneous approach authorized. ▲ Use of FD or AP required during simultaneous operations. For inop ALS, increase LNAV/VNAV visibility all Cats to RVR 6000, and LNAV visibility Cat C/D to 1½ SM.				

ARR 126.45	D-ATIS 128.475	DEP 118.5 307.175	TAMPA APP CON 119.5 269.4	TAMPA TOWER 121.7 269.4	GND CON 121.7 269.4	CLNC DEL 133.6	CPDLC
----------------------	--------------------------	-----------------------------	-------------------------------------	-----------------------------------	-------------------------------	--------------------------	-------

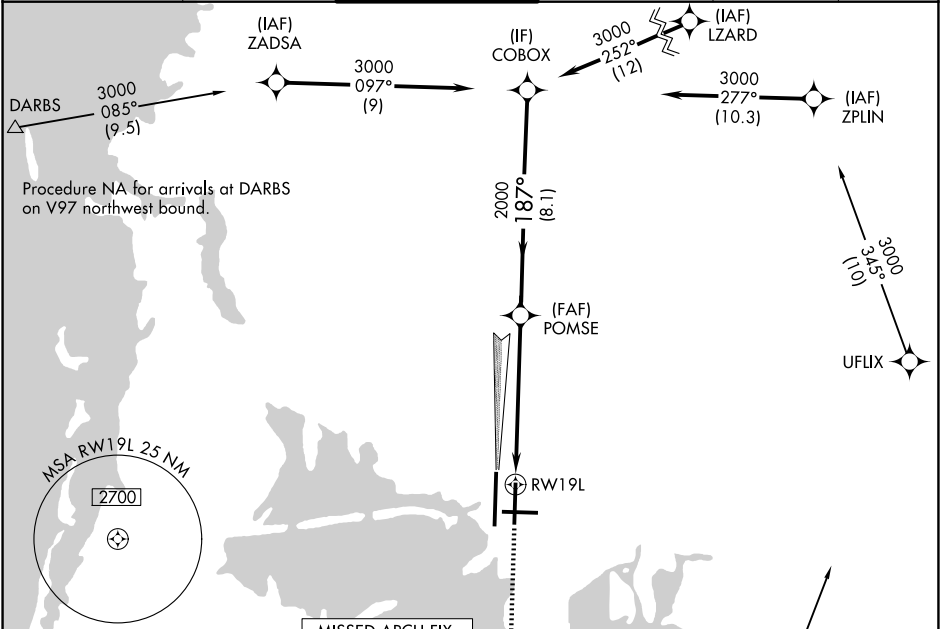

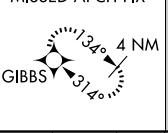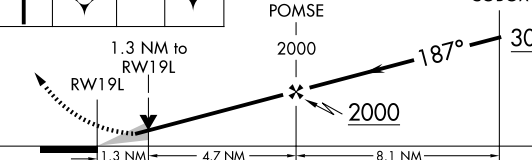MISSED APCH FIX				
				
2000	CUPUL	tr 147°	GIBBS	
VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 74).				
				
CATEGORY	A	B	C	D
LPV DA	226/18 200 (200-½)			
LNAV/VNAV DA	440/40 414 (500-¾)			
LNAV MDA	520/24	494 (500-½)	520/50	494 (500-1)
CIRCLING	600-1	574 (600-1)	680-1¾ 654 (700-1¾)	980-3 954 (1000-3)

SE-3, 22 JAN 2026 to 19 FEB 2026

SE-3, 22 JAN 2026 to 19 FEB 2026