

TACAN RWY 22

TACAN CVS Chan 53	APCH CRS 212°	Rwy Idg 10,001 TDZE 4295 Arpt Elev 4295
-----------------------------	-------------------------	--

[USAF]

CANNON AFB (KCVS)


Missed approach requires use of RNAV or RADAR monitoring.

ALSF-1

MISSED APPROACH: Climb to 6000 out CVS TACAN R-220 to 6 DME (JEBES) then climbing left turn to 7000 intercept CVS R-193 to 12 DME (CLINK) and hold.

T * When ALS inop, increase CAT AB RVR to 55 and vjs to 1 mile, increase CAT CDE vjs to 1¾ miles.

ATIS 119.1 269.9	CANNON APP CON 118.425 352.1	CANNON TOWER 120.4 270.25	GND CON 121.9 275.8	CLNC DEL 120.2 293.225
---------------------	---------------------------------	------------------------------	------------------------	---------------------------

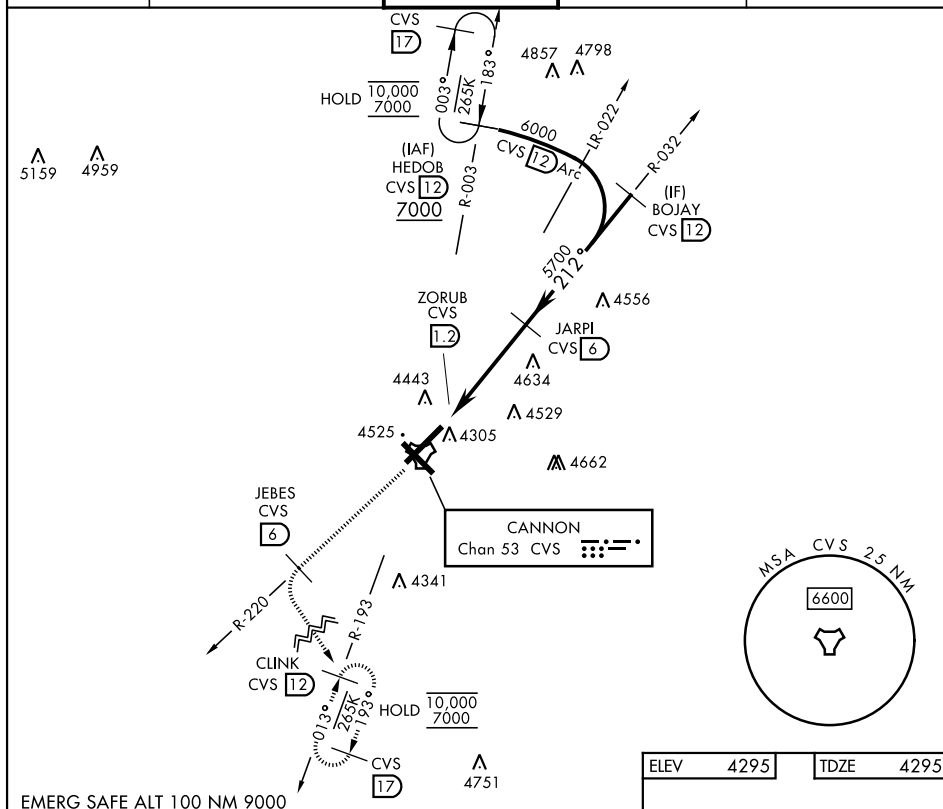


EMERG SAFE ALT 100 NM 9000

6000 CVS R-220	JEBES CVS 6	7000	CLINK CVS 12
----------------------	-------------------	------	--------------------

VGSI and descent angles
not coincident.

CATEGORY	4.8 NM		C	D	E
	A	B			
S-22 *	4900/24	605 (700-½)	4900-1⅜	605 (700-1⅜)	
CIRCLING	4900-1	605 (700-1)	4900-1⅜ 605 (700-1⅜)	5000-2¼ 705 (800-2¼)	5020-2½ 725 (800-2½)

ELEV	4295	TDZE	4295
------	------	------	------

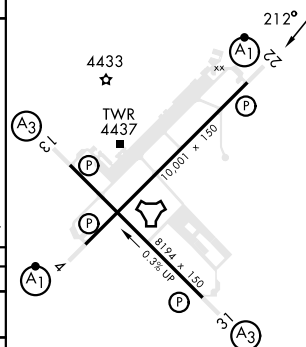

HIRL all rwys

TACAN RWY 22