


APP CRS	Rwy Ldg	8500
308°	TDZE	430
	Apt Elev	477

RNAV (RNP) Y RWY 31L

PALM SPRINGS INTL (PSP)

RNP AR APCH - GPS, RF, min RNP 0.30. Authorization required.	MISSED APPROACH: Climb to 900 then climbing right turn to 4000 direct TANFY and track 107° to BANPE and track 144° to TRM VORTAC and hold. Missed approach requires minimum climb of 365 feet per NM to 2200; if unable to meet climb gradient, see RNAV (GPS) Z RWY 31L.
For uncompensated Baro-VNAV systems, procedure NA below 4°C or above 54°C.	

ATIS 124.65	SOCAL APP CON 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER★ 119.7 (CTAF) 377.05	GND CON 121.9	CLNC DEL 128.35	UNICOM 122.95
----------------	--	--	------------------	--------------------	------------------

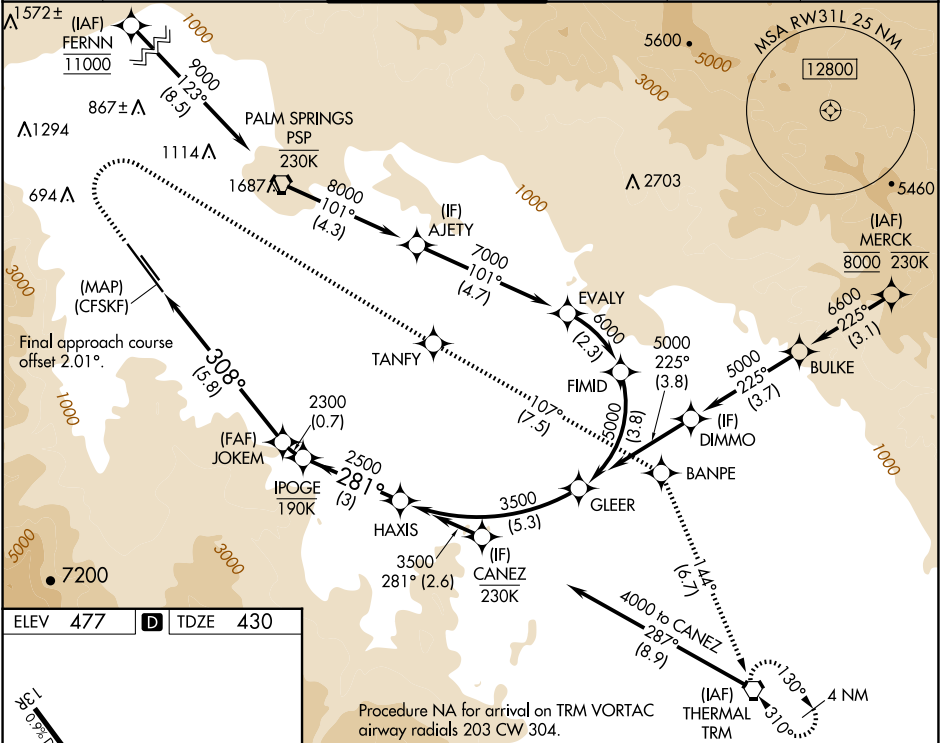

ELEV 477	TDZE 430
See planview for multiple IF locations.	
HAXIS	
3500	
GP 3.00°	
TCH 55	
CATEGORY	
A	
B	
C	
D	
RNP 0.13 DA	
680-¾ 250 (300-¾)	
RNP 0.30 DA	
718-⅞ 288 (300-⅞)	
AUTHORIZATION REQUIRED	