

LOC BC RWY 31
PHILIP BILLARD MUNI (TOP)

MISSED APPROACH: Climbing right turn to 2800 direct TOP VORTAC and hold.

ALTERNATE MISSED APPROACH FIX

R-256
LOM/INT
BILOY
TO ---
521

129°
309°
117.8 TOP
Chan 125
110.7 I-TOP
309°

TOPEKA
117.8 TOP ---
Chan 125

BILOY
521 TO ---

CFTXL
R-176
1149
POACH INT

LOCALIZER 110.7
I-TOP ---

MSA TOP 25 NM
130°
240°
040°
2700
3600
3100

(IAF) CEBAP
TOP 13

R-074

R-025

203°
025°

LR-143

2200
309°
(7.1)

(IF) UJASA RADAR

4000
TOP 13 Arc

2048 A

ELEV 881 | **TDZE 880**

A 1949

4000
309°
(9.2)
112.8 EMP
Chan 75

(IAF) ILEMV INT RADAR


R-042

129°

RADAR REQUIRED BACK COURSE

RADAR REQUIRED
BACK COURSE

2800	TOP	Disregard GS indications.
------	-----	---------------------------

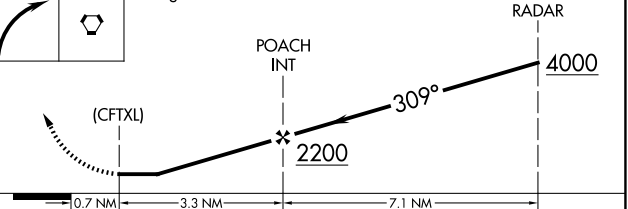

CATEGORY	A	B	C	D
S-31	1400-1	520 (600-1)	1400-1½ 520 (600-1½)	NA
CIRCLING	1400-1 519 (600-1)	1440-1 559 (600-1)	1600-2 719 (800-2)	NA

NC-2, 22 JAN 2026 to 19 FEB 2026

NC-2. 22 JAN 2026 to 19 FEB 2026