


TACAN RWY 20R
FAIRBANKS INTL (FAI) (PAFA)

MALSR

MISSED APPROACH: Climbing left turn to 4000 on heading 160° and FAI VORTAC R-107 to KRNL/FAI 13 DME and hold, continue climb-in-hold to 4000.

ATIS 124.4	FAIRBANKS APP CON 125.35 363.2	FAIRBANKS TOWER 118.3 257.8	GND CON 121.9	CLNC DEL 127.6
---------------	-----------------------------------	--------------------------------	------------------	-------------------

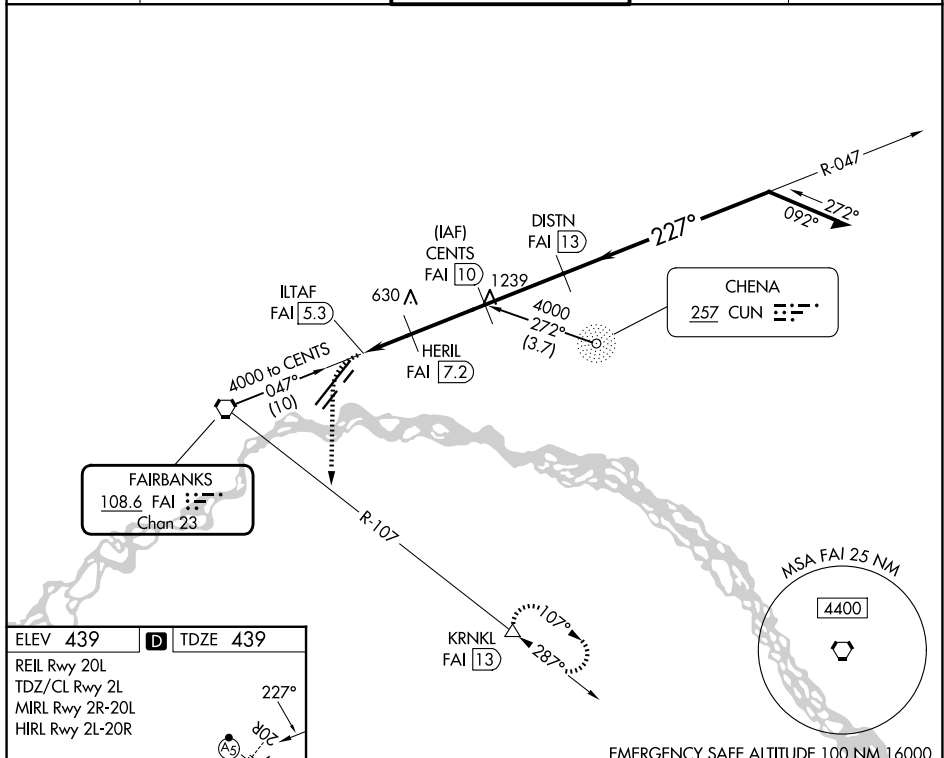

ELEV 439 TDZE 439

REIL Rwy 20L
TDZ/CL Rwy 2L
MIRL Rwy 2R-20L
HIRL Rwy 2L-20R

Knots	60	90	120	150	180
Min:Sec	4:42	3:08	2:21	1:53	1:34

4000 hdg 160°		FAI R-107	KRNKL △	CENTS FAI 10 VGS1 and descent angles not coincident (VGS1 Angle 3.00/TCH 74).	
		HERIL FAI 7.2	DISTN FAI 13		047° Remain within 15 NM
ILTAF FAI 5.3		≤ 3.00° TCH 60	2200	3300	227° 4000
0.7		1.8 NM	2.8 NM	3 NM	
CATEGORY	A	B	C	D	E
S-20R	880/55	441 (500-1)	880-1 ³ / ₈	441 (500-1 ³ / ₈)	1000-1 ⁵ / ₈ 561 (600-1 ¹ / ₂)
CIRCLING	880-1 441 (500-1)	900-1 461 (500-1)	900-1 ¹ / ₂ 461 (500-1 ¹ / ₂)	1020-2 581 (600-2)	1120-2 ¹ / ₂ 681 (700-2 ¹ / ₂)