

VOR/DME or TACAN RWY 10

VORTAC SYA 109.0 Chan 27	APCH CRS 092°	Rwy Idg 10,004 TDZE 98 Arpt Elev 98
--------------------------------	------------------	---

[USAF]

EARECKSON AS (SYA) (PASY)


* When ALS inop, increase CAT AB vis to 1½ miles;
CAT CDE vis to 1¾ miles.
** Circling not authorized N of Rwy 10-28.



MISSED APPROACH: Climb to 1200, then climbing right turn to 4200, intercept SYA R-272 direct EMLAW and hold.

ANCHORAGE CENTER 119.1 339.8	CTAF 127.2 352.05
---------------------------------	----------------------

CAUTION: Numerous obstructions in area N of Rwy 10-28.
Missed approach requires use of RNAV or ATC RADAR monitoring.

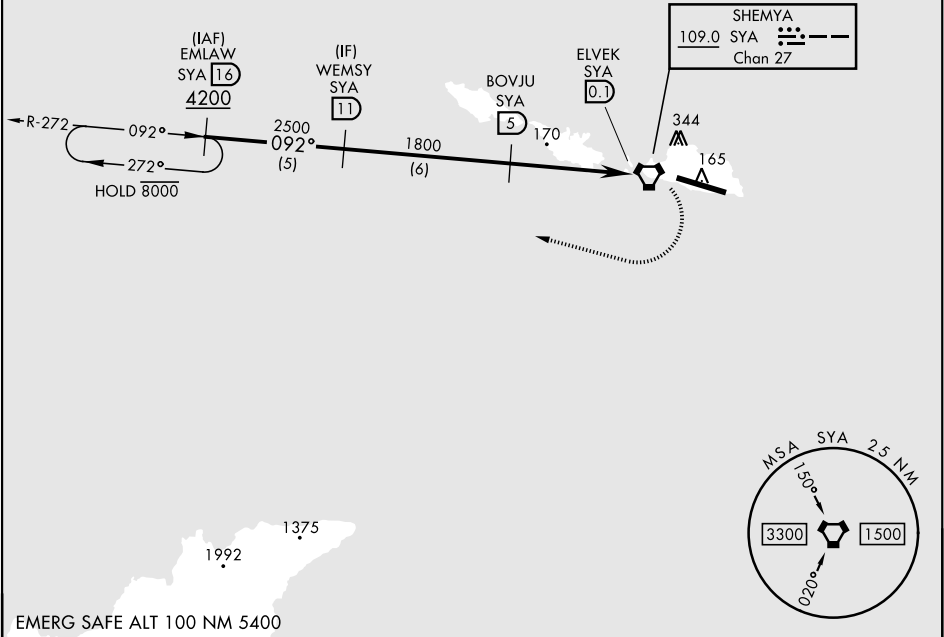

WEMSY SYA 11 2500 BOVJU SYA 5 1800 SYA 0.8 ELVEK SYA 0.1 SYA VORTAC 1200 4200 EMLAW R-272 16 092° 2.56° TCH 46 4.9 NM 1.2 NM						ELEV 98	TDZE 98
CATEGORY	A	B	C	D	E	101 092° A1 A2 TWR 10,004 × 150 28	
S-10 *	640-1	542 (600-1)	640-1½	542 (600-1½)			
CIRCLING **	640-1½	542 (600-1½)	640-1¾ 542 (600-1¾)	660-2 562 (600-2)	680-2 582 (600-2)		
					HIRL Rwy 10-28 REIL Rwy 10 and 28		

VOR/DME or TACAN RWY 10

AK, 22 JAN 2026 to 19 MAR 2026

AK, 22 JAN 2026 to 19 MAR 2026