

WAAS
CH **56239**
W34B

APP CRS
326°

Rwy Ldg
TDZE **182**
Apt Elev **192**

RNAV (GPS) RWY 34L

MANASSAS RGNL/HARRY P DAVIS FLD (HEF)


▼

▲

DME/DME RNP-0.3 NA. When local altimeter setting not received, use Washington Dulles Intl altimeter setting and increase all MDA 60 feet; increase LNAV Cat C/D and Circling Cat C and D visibility ¼ mile. Helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH:
Climbing left turn to 3000
direct CSN VORTAC and hold.

ATIS 125.175	POTOMAC APP CON 128.525 306.925	MANASSAS TOWER ★ 133.1 (CTAF) 0 360.75	GND CON 121.8
------------------------	---	---	-------------------------

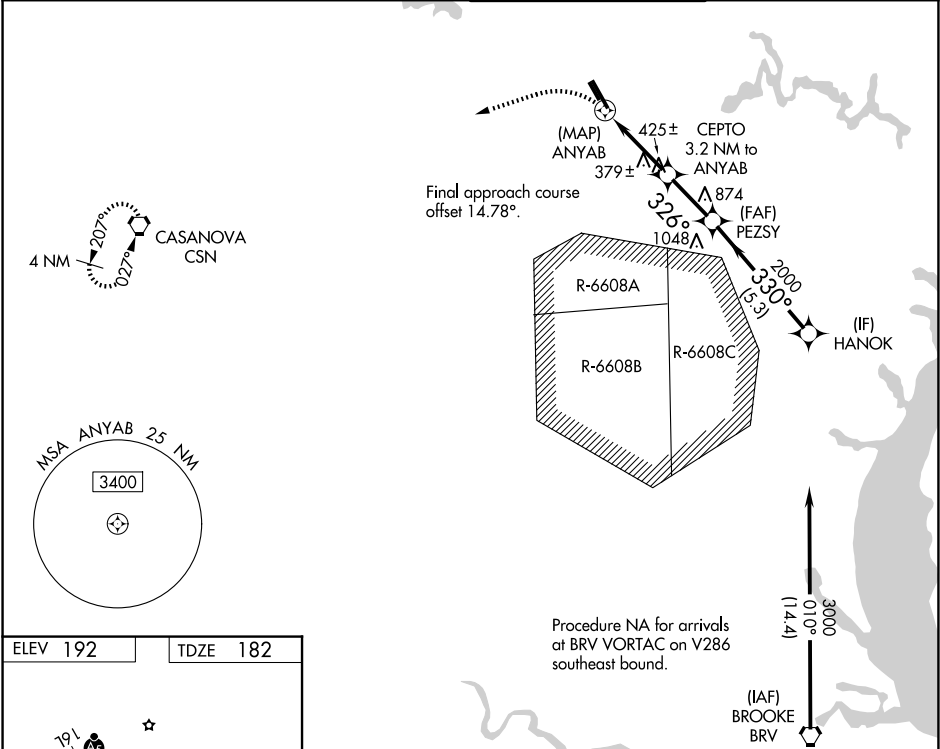

ELEV **192**TDZE **182**

3000	CSN	VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 43).		HANOK	
		CEPTO 3.2 NM to ANYAB	PEZSY	3000	
		0.9 NM to ANYAB		330°	
		ANYAB	1260	2000	
			≤2.79°		
			TCH 40		
		0.4	0.9	2.4 NM	2.3 NM
CATEGORY	A	B	C	D	
LP MDA	640-1	458 (500-1)	640-1 3/8	458 (500-1 3/8)	
LNAV MDA	680-1	498 (500-1)	680-1 3/8	498 (500-1 3/8)	
CIRCLING	720-1 528 (600-1)	740-1 548 (600-1)	840-1 3/4 648 (700-1 3/4)	880-2 1/4 688 (700-2 1/4)	