

LOC I-PEK
110.3

APP CRS
257°

Rwy Ldg **10000**
TDZE **27**
Apt Elev **30**

ILS Y or LOC Y RWY 26
JACKSONVILLE INTL (JAX)


ADF required. RADAR required for procedure entry.

For inop ALS, ZETRI Fix Minimums: increase S-LOC 26 Cats C/D visibility to RVR 5500.

MALSR

MISSED APPROACH: Climb to 3000 direct DINNS LOM and hold, continue climb-in-hold to 3000.

D-ATIS 125.85	JACKSONVILLE APP CON 119.0 269.9	JACKSONVILLE TOWER 118.3 317.7	GND CON 121.9 348.6
-------------------------	--	--	-------------------------------

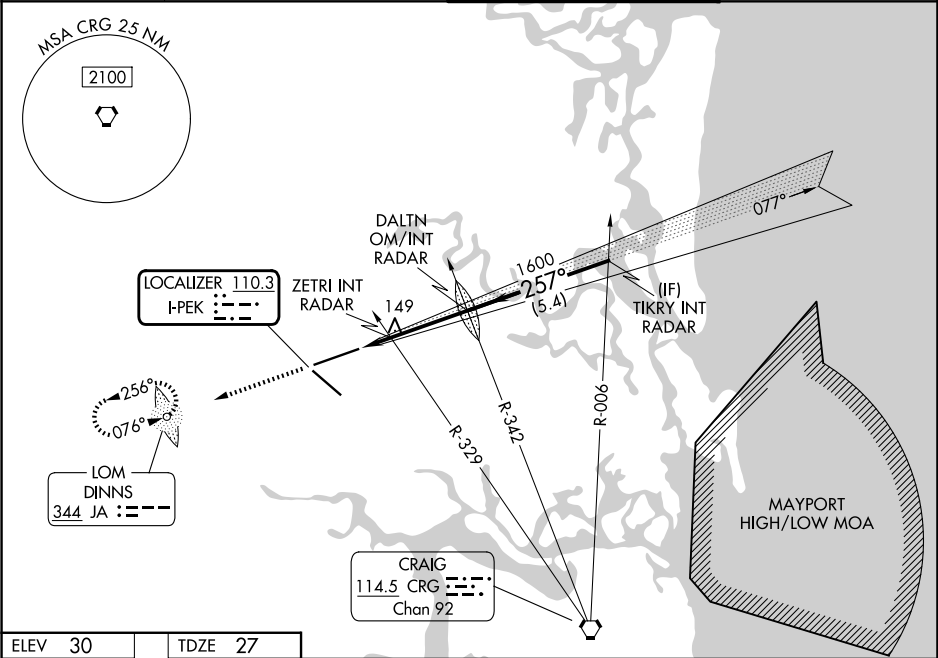

ELEV 30 TDZE 27

REIL Rwy 32
TDZL/RCLS Rwy 8, 14, and 26
HIRL Rwy 8-26 and 14-32

FAF to MAP 4.2 NM

Knots	60	90	120	150	180
Min:Sec	4:12	2:48	2:06	1:41	1:24

3000 ↑	DINNS 	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 70).			