
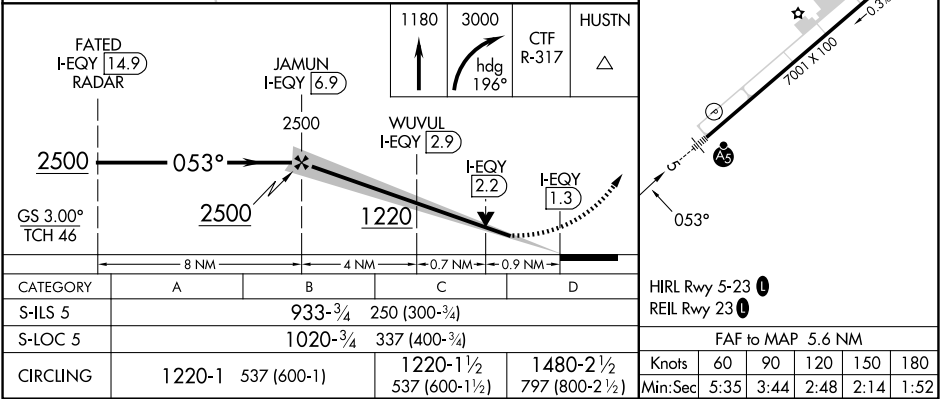


LOC/DME I-EQY 109.75 Chan 34 (Y)	APP CRS 053°	Rwy Ldg TDZE Apt Elev	7001 683 683
--	------------------------	-----------------------------	---

ILS or LOC RWY 5

CHARLOTTE/MONROE EXEC (EQY)

DME required. RADAR required for procedure entry.		MALSR	MISSED APPROACH: Climb to 1180 then climbing right turn to 3000 on heading 196° and CTF VOR/DME R-317 to HUSTN/CTF 20.5 DME and hold, continue climb-in-hold to 3000.
Rwy 5 helicopter visibility reduction below ¾ SM NA. Inop table does not apply to S-ILS 5 all Cats. For inop ALS, increase S-LOC 5 all Cats visibility to 1 SM.			
ASOS 135.775	CHARLOTTE APP CON 120.05 307.8	CLNC DEL 132.55	UNICOM 122.7 (CTAF) 0

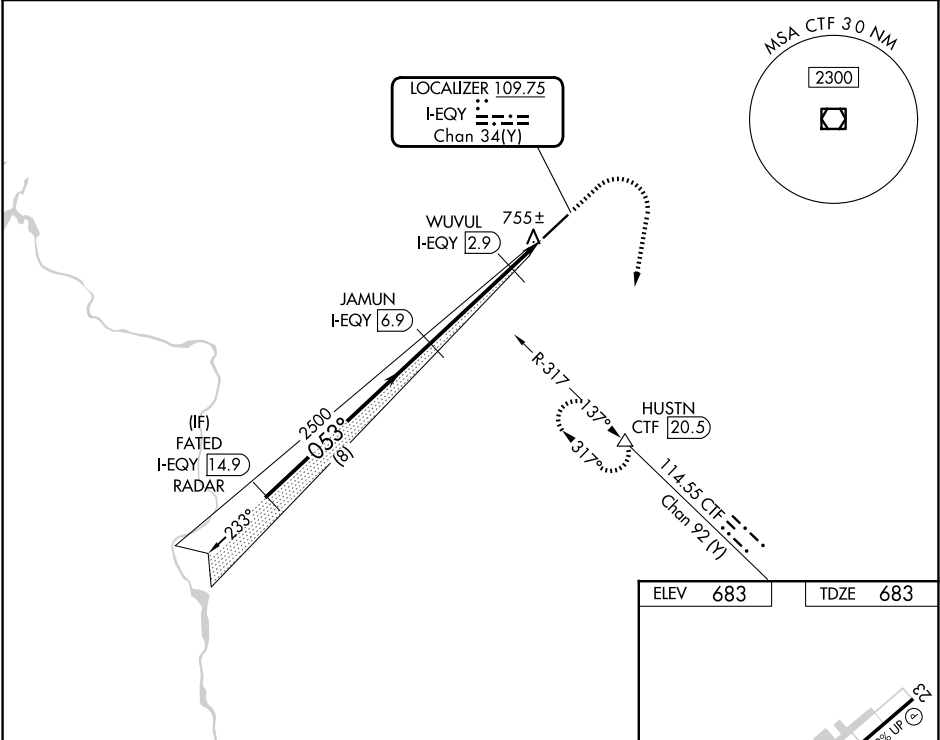

SE-2, 22 JAN 2026 to 19 FEB 2026

SE-2, 22 JAN 2026 to 19 FEB 2026