


LOC/DME I-BIH	APP CRS	Rwy Idg	5600
109.1	141°	TDZE	4113
Chan 28		Apt Elev	4124

LDA RWY 17

BISHOP (BIH)

DME required.	MISSED APPROACH: Climbing right turn to 12500 on heading 355° and on BIH VOR/DME R-328 to JABIM INT/OAL 39.5 DME and hold.
---------------	--

ASOS 119.025	OAKLAND CENTER 125.75 284.65	UNICOM 123.0 (CTAF) 0
-----------------	---------------------------------	--------------------------

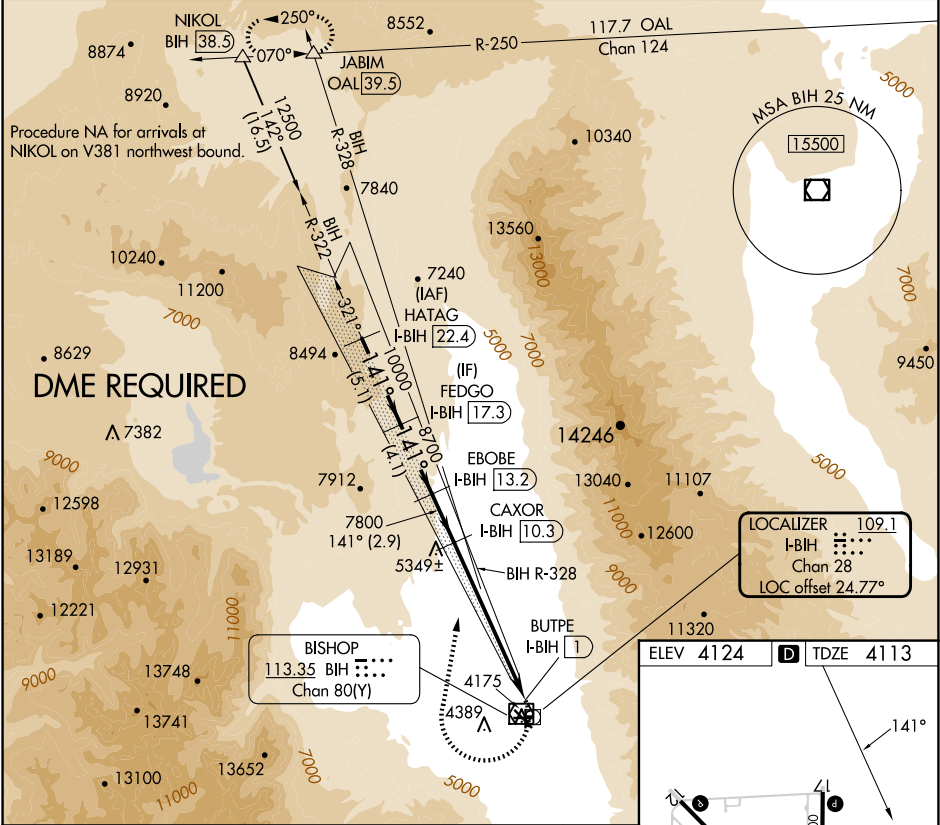

HATAG I-BIH <u>22.4</u>				VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 39).				12500	BIH R-328	JABIM △
FEDGO I-BIH <u>17.3</u>				EBOBE I-BIH <u>13.2</u>				Use I-BIH DME when on the localizer course.		
12500				141°				hdg 355°		
10000				8700				3.50° TCH 50		
7800				5.1 NM				BUTPE I-BIH <u>1</u>		
				4.1 NM						
				2.9 NM						
				9.3 NM						
				0.5						
CATEGORY	A		B		C		D			
S-17	6340-1¼ 2227 (2300-1¼)		6340-1½ 2227 (2300-1½)		6340-3		2227 (2300-3)			

