

WAAS CH 90505 W04A	APP CRS 037°	Rwy Ldg TDZE Apt Elev 5500 904 904
--	------------------------	--

RNAV (GPS) RWY 4

BOLTON FLD (TZR)

RNP APCH.


T

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to 1¼ SM and LNAV Cats C/D visibility to 1½ SM.

MALSR

MISSED APPROACH:
Climb to 3000 direct OYILU and left turn on track 294° to MECAN and hold.

AWOS-3PT 135.925	COLUMBUS APP CON 134.0 279.6	BOLTON TOWER ★ 128.1 (CTAF) 0	GND CON 121.8
----------------------------	--	---	-------------------------

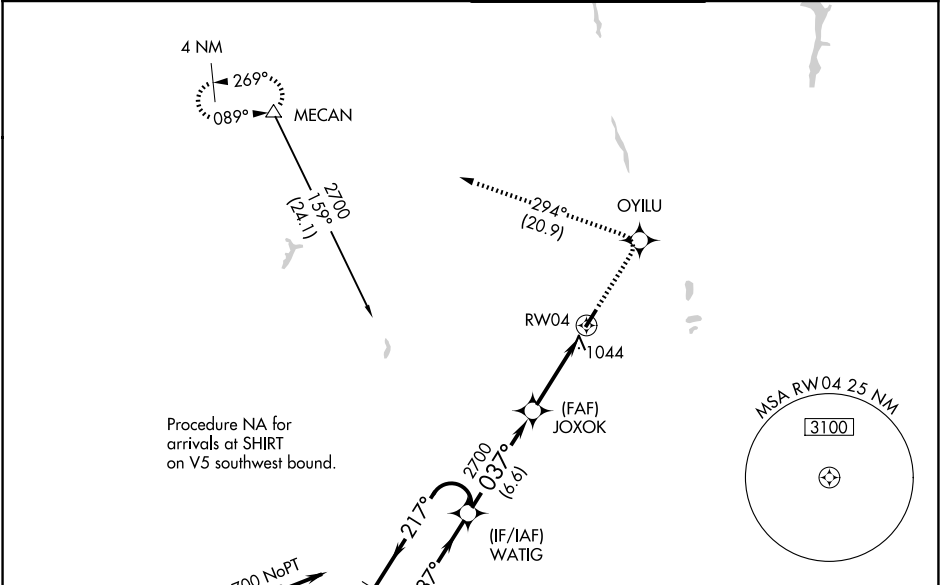

4 NM Holding Pattern

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 25).

3000

OYILU

MECAN

tr 294°

WATIG

JOXOK

*LNAV only.

6000

2700

217°

037°

037°

2700

1.4 NM to RW04

RW04

GP 3.00°

TCH 39

6.6 NM

4 NM

1.4

CATEGORY	A	B	C	D
LPV DA	1163-½ 259 (300-½)			
LNAV/VNAV DA	1325-1 421 (500-1)			
LNAV MDA	1360-½ 456 (500-½)	1360-⅞ 456 (500-⅞)	1360-1 456 (500-1)	1360-1 456 (500-1)
CIRCLING	1360-1 456 (500-1)	1380-1 476 (500-1)	1380-1½ 476 (500-1½)	1500-2 596 (600-2)

ELEV 904

TDZE 904

REIL Rwy 22 0

MIRL Rwy 4-22 0