

COLUMBUS, OHIO

AL-6846 (FAA)



26022

LOC/DME I-DDV	APP CRS	Rwy Ldg	12103
110.1	052°	TDZE	736
Chan 38		Apt Elev	744

ILS RWY 5R (CAT II)
RICKENBACKER INTL (LCK)


ADF or DME required.	ALSIF-2	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
NA	A	

ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8
----------------	---------------------------------	----------------------------	--------------------------

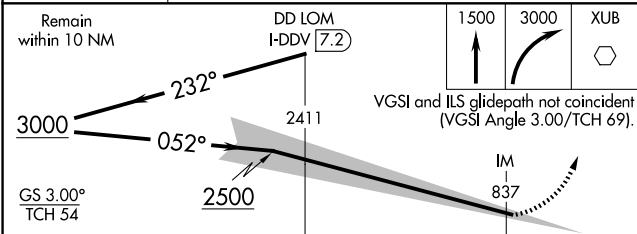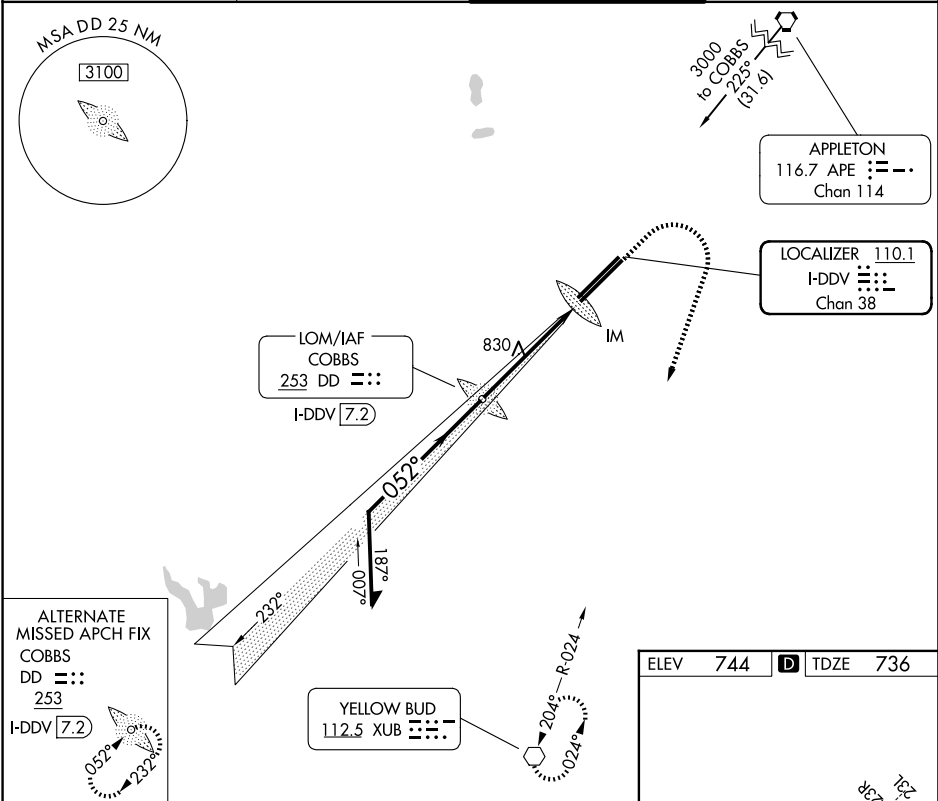

CATEGORY	A	B	C	D
S-ILS 5R		RA 100/12	100 DA 836	

CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

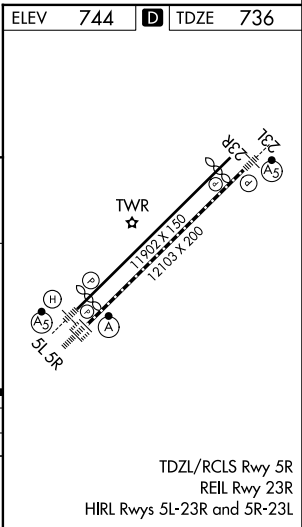

COLUMBUS, OHIO
Amdt 3E 09SEP21

39°49'N-82°56'W

RICKENBACKER INTL (LCK)
ILS RWY 5R (CAT II)

EC-2, 22 JAN 2026 to 19 FEB 2026

EC-2, 22 JAN 2026 to 19 FEB 2026