

WAAS CH 93529 W17B	APP CRS 173°	Rwy Ldg 12000 TDZE 5392 Apt Elev 5434
--	------------------------	--

RNAV (GPS) Y RWY 17R

DENVER INTL (DEN)

⚠

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -25°C (-13°F) or above 46°C (116°F). Simultaneous approach authorized with Rwy 16L/16R and 17L. DME/DME RNP-0.3 NA. For inoperative MALSR, increase LNAV/VNAV all Cats visibility to 1½ mile, and LNAV Cat C/D to 1½ mile. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations.

MALSR





MISSED APPROACH:

Climb to 10000 direct JAKUR and on track 200° to HOHUM and hold.

D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 124.3 322.45	GND CON 121.35 379.175 (W) 121.85 377.1 (E)
------------------------------	---	-------------------------------------	---

RADAR REQUIRED

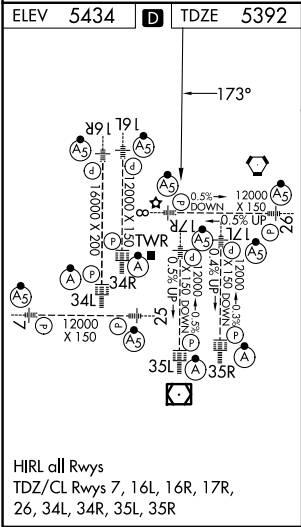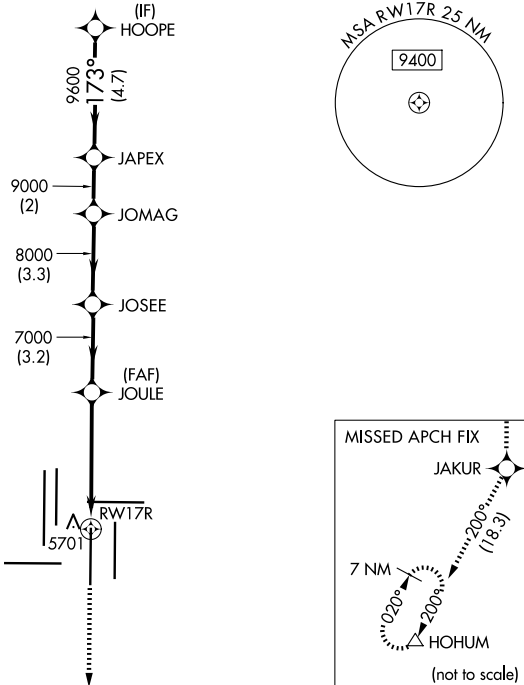

10000 ↑	JAKUR ✱	tr 200°	HOHUM △	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00°/TCH 69°).				
*LNAV only				JOULE 7000	JOSEE 8000	JOMAG 9000	JAPEX 9600	HOOPE 11000
*1.6 NM to RW17R				7000			173°	
RW17R				7000				GP 3.00° TCH 60
1.6				3.3 NM	3.2 NM	3.3 NM	2 NM	4.7 NM
CATEGORY		A		B		C		D
LPV	DA	5592/18 200 (200-½)						
LNAV/ VNAV	DA	5857/60 465 (500-1¼)						
LNAV	MDA	5940/24 548 (600-½)			5940-1¼ 548 (600-1¼)			