


APP CRS	Rwy Ldg	<b>8000</b>
<b>281°</b>	TDZE	<b>813</b>
	Apt Elev	<b>815</b>

# RNAV (RNP) Z RWY 28R


JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH.	MALSR	MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 to APE VORTAC and hold.
<p>For uncompensated Baro-VNAV systems, procedure NA below -19°C or above 54°C. For inop ALS, increase RNP 0.16 all Cats visibility to RVR 4500 and increase RNP 0.30 all Cats visibility to RVR 5500. Simultaneous approach authorized.</p>		

D-ATIS <b>124.6</b>	COLUMBUS APP CON <b>125.95 371.975</b>	COLUMBUS TOWER <b>132.7 257.8</b>	GND CON <b>121.9 348.6</b>
------------------------	---	--------------------------------------	-------------------------------

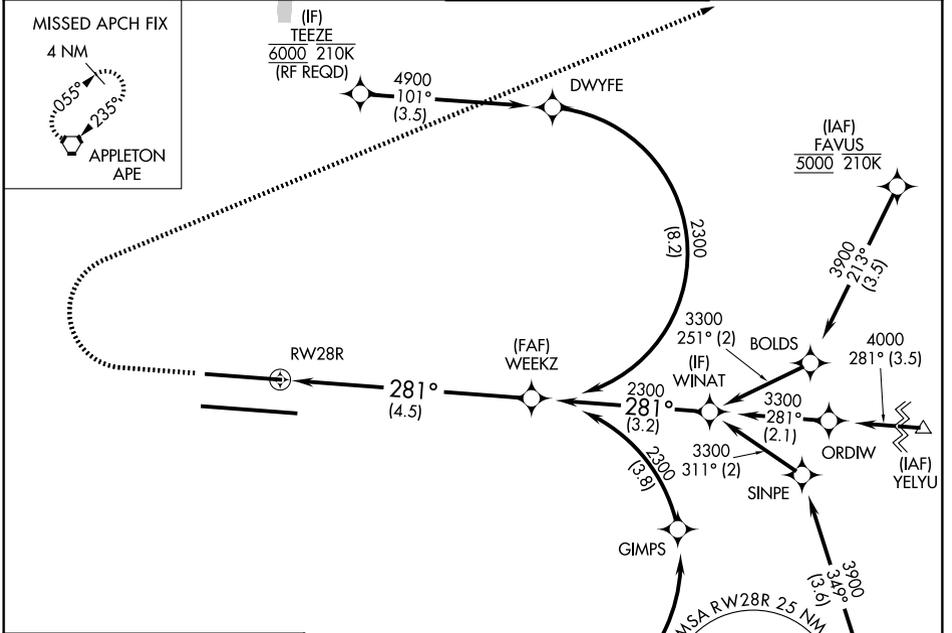

ELEV 815	<b>D</b>	TDZE 813
----------	----------	----------

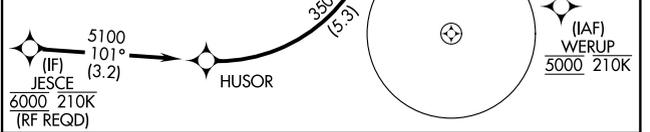

WEEKZ	2300
RW28R	281°
4.5 NM	
GP 3.00°	TCH 50

CATEGORY	A	B	C	D
RNP 0.16 DA	1129/24	316 (400-½)		
RNP 0.30 DA	1185/35	372 (400-¾)		

TDZL/RCLS Rwy 10R-28L  
HIRL Rwy 10R-28L and 10L-28R

## AUTHORIZATION REQUIRED

EC-2, 19 FEB 2026 to 19 MAR 2026

EC-2, 19 FEB 2026 to 19 MAR 2026