

GOLDSBORO, NORTH CAROLINA

# TACAN Y RWY 26

TACAN GSB Chan <b>112</b>	APCH CRS <b>261°</b>	Rwy ldg <b>11,760</b> TDZE <b>109</b> Arprt Elev <b>109</b>
---------------------------	----------------------	---

[USAF]


SEYMOUR JOHNSON AFB (KGSB)

▼ \* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1½ miles.  
\*\* Circling N of Rwy 8-26 not authorized.



MISSED APPROACH: Climb to 2200 via GSB R-261 to TULME and hold.

ATIS ★ <b>317.625</b>	APP CON <b>123.7 290.9</b> (258°-110°) <b>119.7 273.6</b> (111°-257°)	TOWER ★ <b>126.25 370.875</b>	GND CON <b>132.45 275.8</b>	CLNC DEL <b>128.025 270.8</b>
-----------------------	--	-------------------------------	-----------------------------	-------------------------------

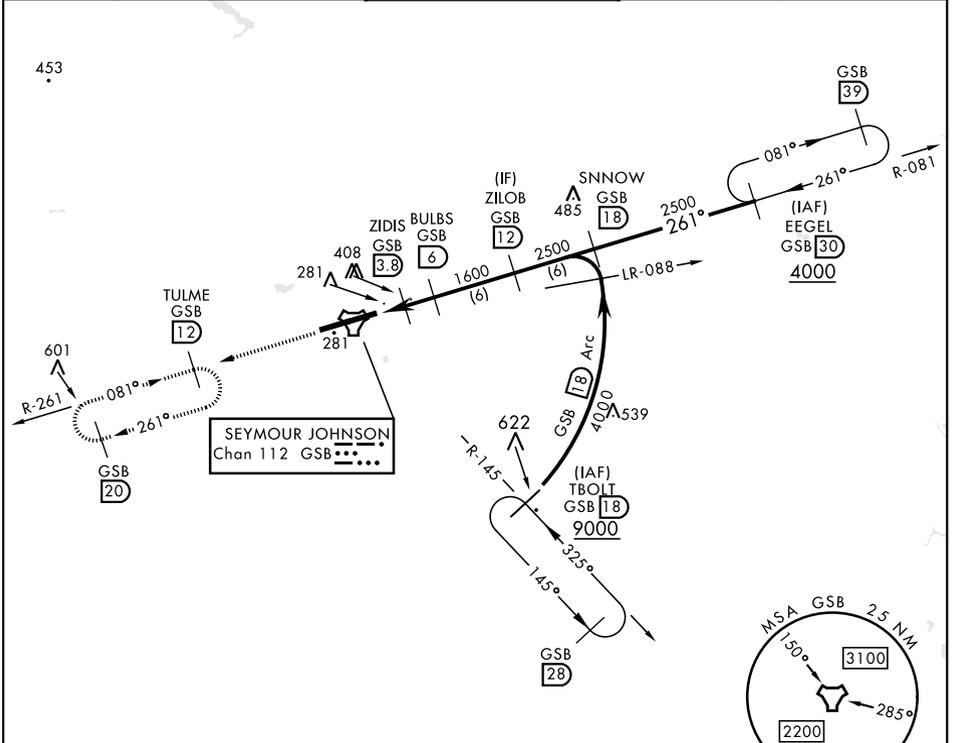

SE-2, 19 FEB 2026 to 19 MAR 2026

SE-2, 19 FEB 2026 to 19 MAR 2026

EMERG SAFE ALT 100 NM 3700

ELEV 109	TDZE 109																		
<table border="1"> <tr> <th>CATEGORY</th> <th>A</th> <th>B</th> <th>C</th> <th>D</th> <th>E</th> </tr> <tr> <td>S-26 *</td> <td>540/24</td> <td>431 (500-½)</td> <td>540/40</td> <td>431 (500-¾)</td> <td></td> </tr> <tr> <td>CIRCLING **</td> <td>580-1 471 (500-1)</td> <td>600-1 491 (500-1)</td> <td>680-1½ 571 (600-1½)</td> <td>740-2 631 (700-2)</td> <td>740-2¼ 631 (700-2¼)</td> </tr> </table>	CATEGORY	A	B	C	D	E	S-26 *	540/24	431 (500-½)	540/40	431 (500-¾)		CIRCLING **	580-1 471 (500-1)	600-1 491 (500-1)	680-1½ 571 (600-1½)	740-2 631 (700-2)	740-2¼ 631 (700-2¼)	
CATEGORY	A	B	C	D	E														
S-26 *	540/24	431 (500-½)	540/40	431 (500-¾)															
CIRCLING **	580-1 471 (500-1)	600-1 491 (500-1)	680-1½ 571 (600-1½)	740-2 631 (700-2)	740-2¼ 631 (700-2¼)														

GOLDSBORO, NORTH CAROLINA

35° 20' N - 77° 58' W

SEYMOUR JOHNSON AFB (KGSB)

Amtd 8 03NOV22

# TACAN Y RWY 26