

(MARC'S, QERVO3) 27NOV25

QERVO THREE ARRIVAL (RNAV) Transition Routes

SAN ANTONIO, TEXAS

SAN ANTONIO APP CON
 127.1 269.1
 BAZ ATIS
 119.325
 KRND ATIS ★
 290.525
 SAT D-ATIS
 118.9
 SKF ATIS
 120.45 273.5
 SSF ATIS
 128.8


RNAV 1-DME/DME/IRU or GPS.
 RADAR required.

ANNGY TRANSITION (ANNGY.QERVO3)
 BLEWE TRANSITION (BLEWE.QERVO3)
 CAAGE TRANSITION (CAAGE.QERVO3)
 MOLLR TRANSITION (MOLLR.QERVO3)
 WAILN TRANSITION (WAILN.QERVO3)
 WINDU TRANSITION (WINDU.QERVO3)

(MARC'S, QERVO3) 25331

AL-369 (FAA)
 QERVO THREE ARRIVAL (RNAV) Transition Routes

SAN ANTONIO, TEXAS

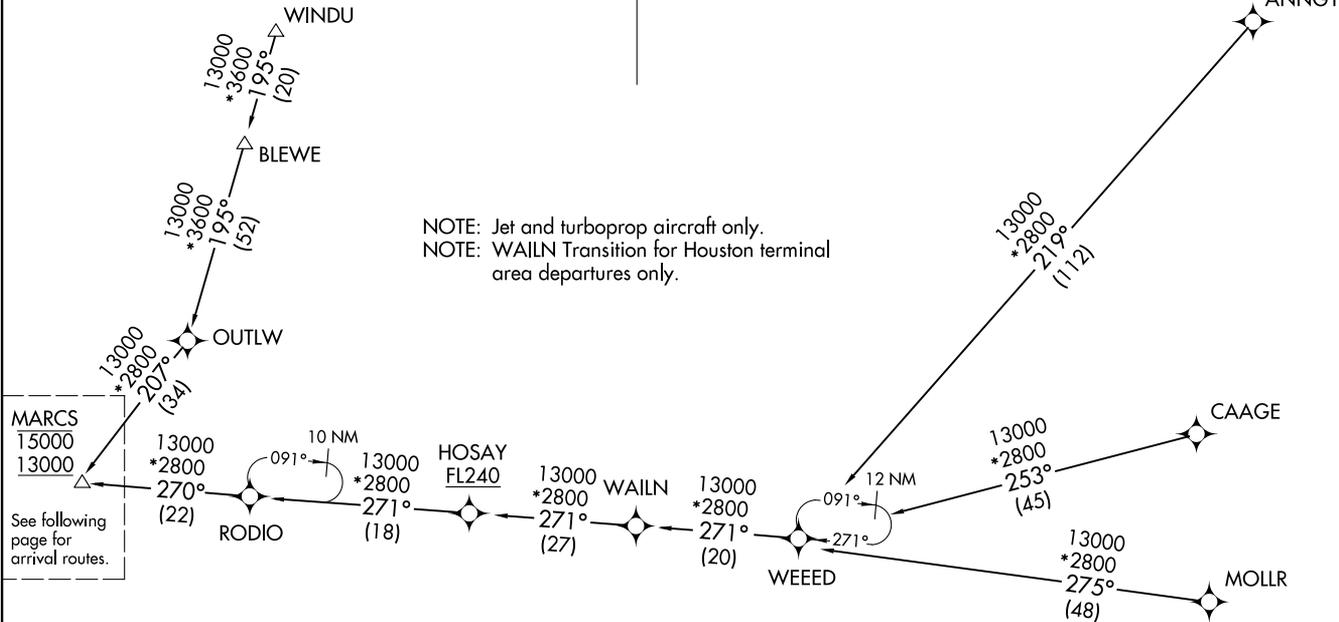

NOTE: Jet and turboprop aircraft only.
 NOTE: WAILN Transition for Houston terminal area departures only.

MARC'S
 15000
 13000

See following page for arrival routes.

NOTE: Chart not to scale.

(CONTINUED ON FOLLOWING PAGE)

QERVO THREE ARRIVAL (RNAV)

SAN ANTONIO, TEXAS

ARRIVAL ROUTE DESCRIPTION

SAN ANTONIO INTL (SAT): From MARCS on track 245° to cross PGOUT between 11000 and 13000 and at 280K, then on track 245° to QERVO.

LANDING SAT RUNWAY 4: From QERVO on track 217° to cross TEXNN between 8000 and 9000, then on track 217° to cross JEFRE at or above 7000, then on track 217° to cross MCRTY at 6000 and at 210K, then on track 217°. Expect RADAR vectors to final approach course.

LANDING SAT RUNWAY 13R: From QERVO on track 245° to cross TAHKO at or below 11000, then on track 245° to cross FJITA at or below 8000, then on track 245° to TRTLA, then on track 246° to cross SALZA at 6000 and at 210K, then on track 268° to DOMNK, then on track 308° to cross CARNE at 6000, then on track 308°. Expect RADAR vectors to final approach course.

LANDING SAT RUNWAY 22: From QERVO on track 274° to cross TRITP at 7000 and at 210K, then on track 274°. Expect RADAR vectors to final approach course.

LANDING SAT RUNWAY 31L: From QERVO on track 229° to DERRR, then on track 228° to cross COMUT at 6000 and at 210K, then on track 164° to ALRGI, then on track 128° to cross XLANT at 6000, then on track 128°. Expect RADAR vectors to final approach course.

LANDING SKF/BAZ/CVB/SSF/PEZ/5C1/RND: From MARCS on track 245° to cross PGOUT between 11000 and 13000 and at 280K, then on track 245° to QERVO, then on track 245° to cross POYYO at 10000, then on track 245°. Expect RADAR vectors to final approach course.

LOST COMMUNICATIONS

SAT RUNWAY 4: After MCRTY, proceed to FOALL at 5000, then on ILS or LOC RWY 4 or RNAV (GPS) Y RWY 4 approach.

SAT RUNWAY 13R: After CARNE, proceed to RBNSN at 6000 and hold.

SAT RUNWAY 22: After TRITP proceed to AREEA at 5000, then on RNAV (GPS) Y RWY 22 approach.

SAT RUNWAY 31L: After XLANT, proceed to SLOW at 4000 and hold.

SC-3, 19 FEB 2026 to 19 MAR 2026

SC-3, 19 FEB 2026 to 19 MAR 2026