

# HI-TACAN RWY 32

TACAN BKF Chan <b>33</b>	APCH CRS <b>328°</b>	Rwy Idg <b>11,006</b> TDZE <b>5663</b> Arprt Elev <b>5663</b>
-----------------------------	-------------------------	---



AL-538 [USAF]

BUCKLEY SFB (KBKF)

▼ * When ALS inop, increase CAT CDE vis to 1 3/4 miles. ** Circling NA East of Rwy 14-32.	ALSF-1 	MISSED APPROACH: Climbing right turn to 8200 and intercept BKF TACAN R-148 direct BEKEE and hold or as directed by ATC.


ATIS ★ <b>119.675 259.3</b>	DENVER APP CON <b>128.45 251.075</b>	TOWER ★ <b>121.0 291.675</b>	GND CON <b>121.6 275.8</b>	CLNC DEL <b>121.6 275.8</b>
--------------------------------	---	---------------------------------	-------------------------------	--------------------------------

Missed approach requires use of RNAV or ATC RADAR monitoring.

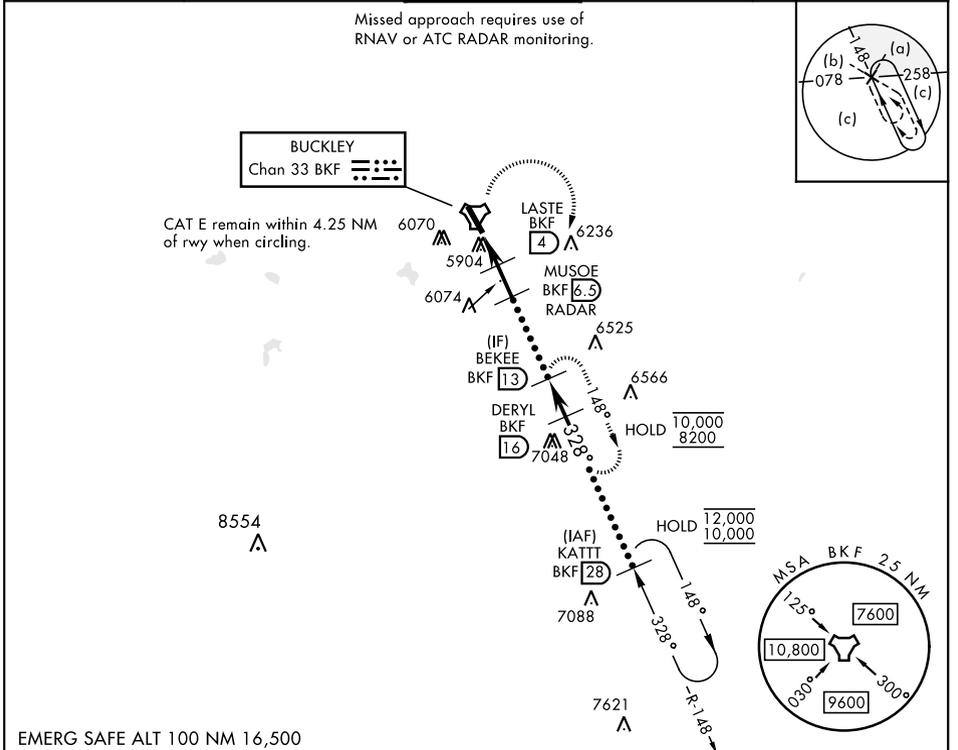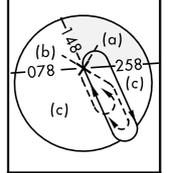

EMERG SAFE ALT 100 NM 16,500

8200 BKF R-148	BEKEE BKF 13	DERYL 16	KATTT 28	ELEV 5663	TDZE 5663
CATEGORY	C	D	E		
S-32 *	6280-1 3/8 617 (700-1 3/8)				
CIRCLING **	6360-2 697 (700-2)	6400-2 1/4 737 (800-2 1/4)	6420-2 3/4 757 (800-2 3/4)		

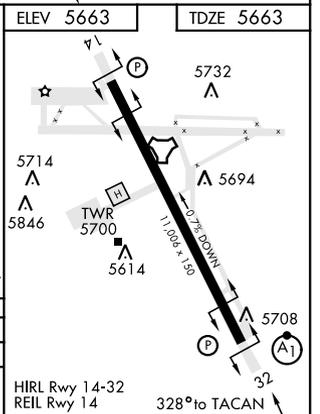

# HI-TACAN RWY 32

SW-1, 19 FEB 2026 to 19 MAR 2026

SW-1, 19 FEB 2026 to 19 MAR 2026