


TACAN BKF Chan 33	APCH CRS 328°	Rwy ldg 11,006 TDZE 5663 Arprt Elev 5663	AL-538 [USAF]	BUCKLEY SFB (KBKF)
-----------------------------	-------------------------	---	---------------	--------------------

▼ * When ALS inop, increase CAT AB RVR to 55 and vis to 1 mile, CAT CDE vis to 1¾ miles.
 ** Circling NA east of Rwy 14-32.

ALSF-1 A1 MISSED APPROACH: Climbing right turn to 8200 and intercept BKF TACAN R-148 direct BEKEE and hold or as directed by ATC.


ATIS ★ 119.675 259.3	DENVER APP CON 128.45 251.075	TOWER ★ 121.0 291.675	GND CON 121.6 275.8	CLNC DEL 121.6 275.8
--------------------------------	---	---------------------------------	-------------------------------	--------------------------------

Missed approach requires use of RNAV or ATC RADAR monitoring.

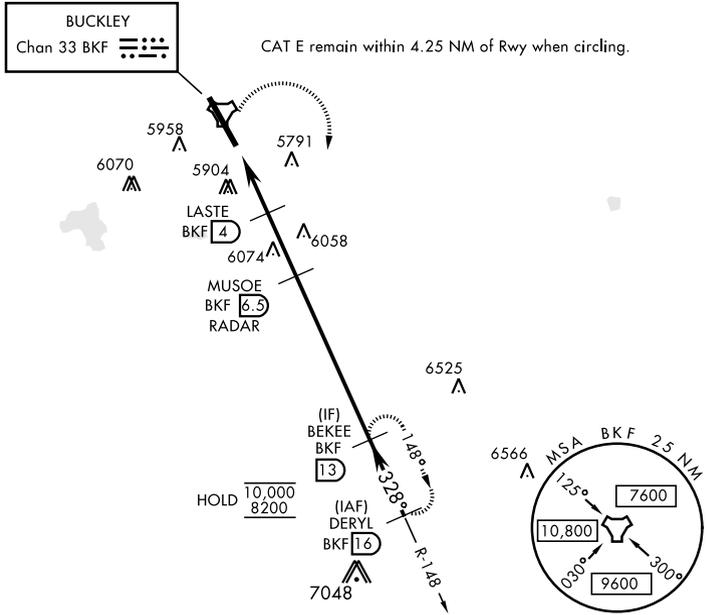

EMERG SAFE ALT 100 NM 16,500

8200 BKF R-148	BEKEE BKF 13					
TACAN	CENAR 1.7	LASTE 4	MUSOE 6.5 RADAR	BEKEE 13	DERYL 16	8100
	6600	7400	8000	328°	8100	
	0.5 NM	2.3 NM	2.5 NM			3.02°
CATEGORY	A	B	C	D	E	
S-32*	6280/24	617 (700-½)	6280-1⅓	617 (700-1⅓)		
CIRCLING**	6280-1	617 (700-1)	6360-2	6400-2¼	6420-2¾	
			697 (700-2)	737 (800-2¼)	757 (800-2¾)	

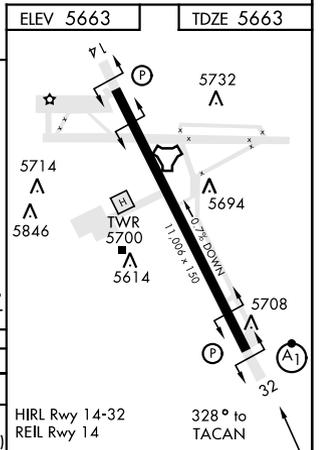

SW-1, 19 FEB 2026 to 19 MAR 2026

SW-1, 19 FEB 2026 to 19 MAR 2026