

WAAS CH 48944 W32A	APP CRS 325°	Rwy Ldg 4538 TDZE 337 Apt Elev 345
--	------------------------	---

RNAV (GPS) RWY 32

FITCHBURG MUNI (FIT)


RNP APCH - GPS.

- | | |
|---|---|
|  | Rwy 32 helicopter visibility reduction below 1 SM NA. |
| | Procedure NA when R-4102 A & B are active. |
|  -21°C | Circling NA southwest of Rwy 14-32 at night. |

MISSED APPROACH: Climb to 3500 direct TAYUN and on track 041° to DALIA and hold.

ASOS 135.175	BOSTON APP CON 124.4 279.6	UNICOM 122.7 (CTAF)	123.0 
------------------------	--------------------------------------	-------------------------------	--

MISSED APCH FIX

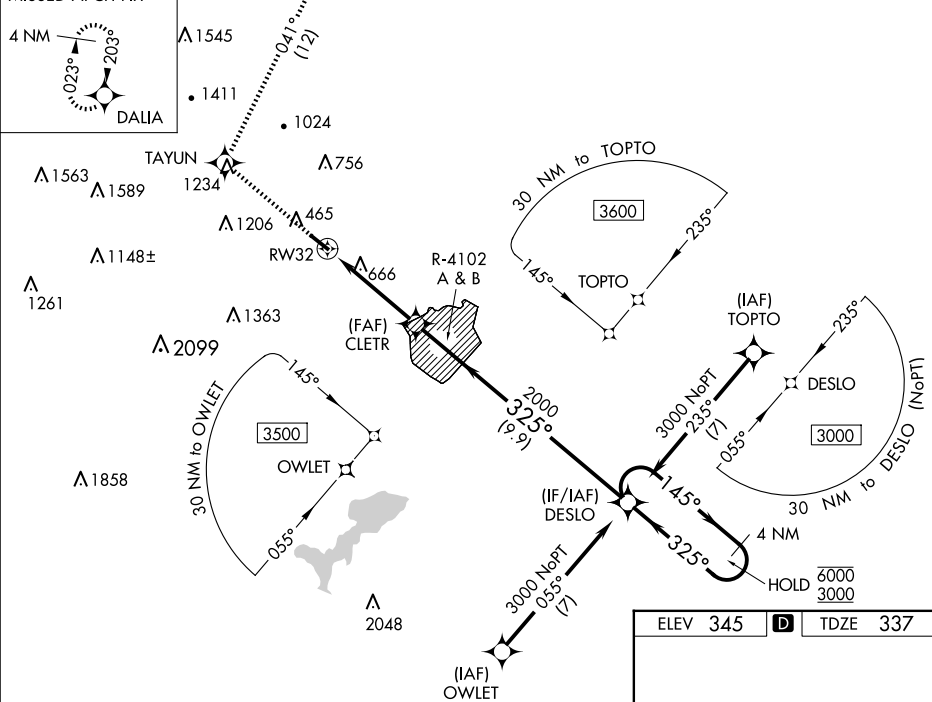

3500 TAYUN DALIA

tr 041°

VGSI and RNAV glidepath not coincident (VGSI Angle 3.50/TCH 46).

DESLO

4 NM Holding Pattern

145°

325°

6000

3000

CLETR

2000

325°

2000


RW32

4.2 NM

9.9 NM

GP 3.62° TCH 65

CATEGORY	A	B	C	D
LPV DA	773-1¼ 436 (500-1¼)			NA
LNAV MDA	960-1	623 (700-1)	960-1¾ 623 (700-1¾)	NA
C CIRCLING	1080-1 735 (800-1)	1380-1½ 1035 (1100-1½)	1520-3 1175 (1200-3)	NA

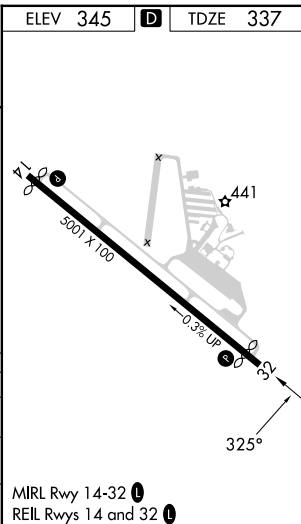

RNAV (GPS) RWY 32