



LOC I-JAN 110.5	APP CRS 159°	Rwy Ldg TDZE Apt Elev	8500 312 346
---------------------------	------------------------	-----------------------------	---

ILS RWY 16L (SA CAT I)



JACKSON-MEDGAR WILEY EVERS INTL (JAN)

▽ When control tower closed, procedure NA. ▲ When local altimeter setting not received, procedure NA. ASR Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DA.	ALSF-2 	MISSED APPROACH: Climb to 800 then climbing left turn to 3000 on heading 090° and on MHz VORTAC R-134 to RAKIN INT/16.5 DME and hold, continue climb-in-hold to 3000.

ATIS 121.05	JACKSON APP CON * 123.9 317.7	JACKSON TOWER * 120.9 (CTAF) 352.0	GND CON 121.7 348.6	UNICOM 122.95
-----------------------	---	--	-------------------------------	-------------------------

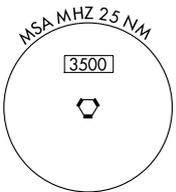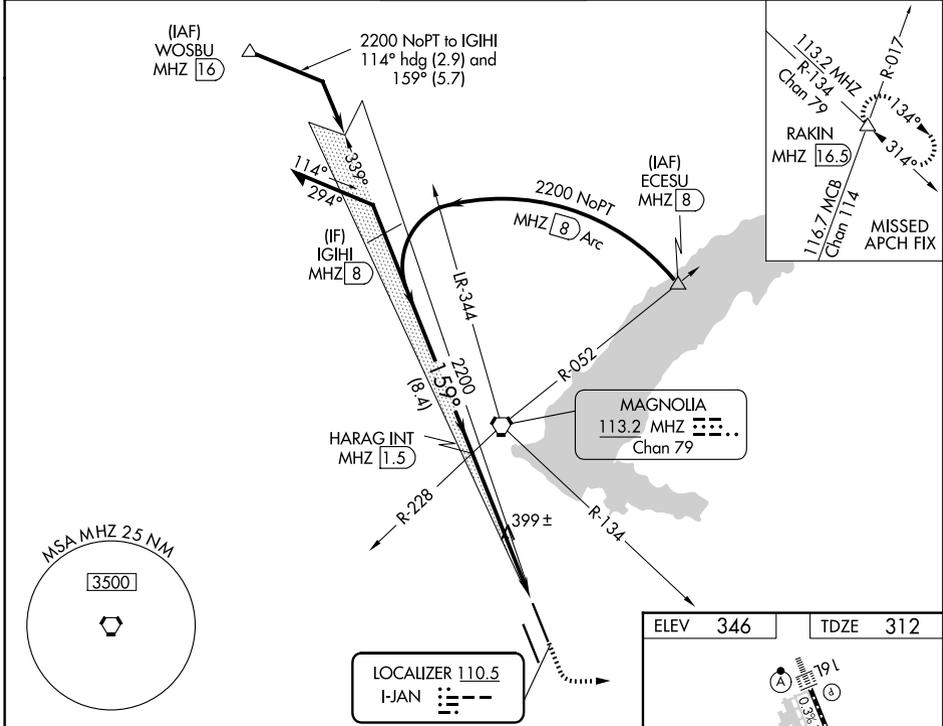

ELEV 346	TDZE 312
----------	----------

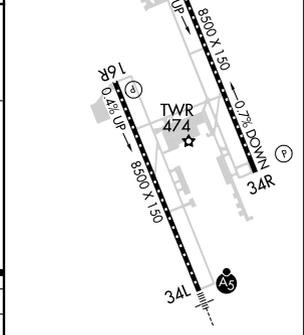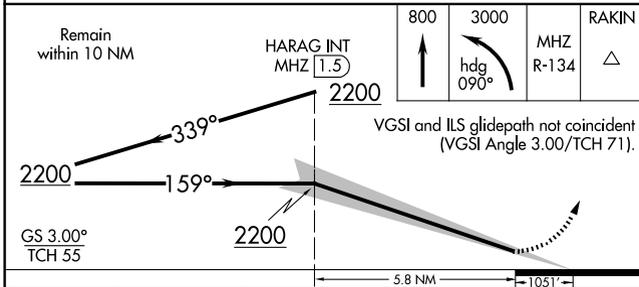

SA CATEGORY I ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

CATEGORY	A	B	C	D
S-ILS 16L		RA 169/14	150 DA 462	

TDZL/RCLS Rws 16L and 34L
REIL Rws 16R and 34R
HIRL Rws 16L-34R and 16R-34L

SC-4, 19 FEB 2026 to 19 MAR 2026

SC-4, 19 FEB 2026 to 19 MAR 2026