

NDB IRS <b>382</b>	APP CRS <b>165°</b>	Rwy Ldg TDZE Apt Elev	<b>5201</b> <b>915</b> <b>925</b>
-----------------------	------------------------	-----------------------------	---

# NDB RWY 19




KIRSCH MUNI (IRS)

RADAR required for procedure entry.

**⚠** Procedure NA at night. Rwy 19 helicopter visibility reduction below 1 SM NA.

MISSED APPROACH: Climb to 2500 then left turn direct IRS NDB and hold.

AWOS-3 <b>121.325</b>	GREAT LAKES APP CON * <b>121.2 239.25</b>	UNICOM <b>123.05 (CTAF) 0</b>
--------------------------	--	----------------------------------

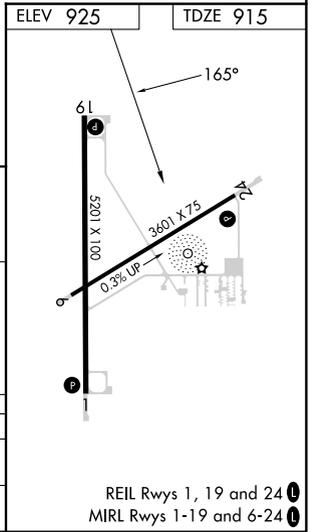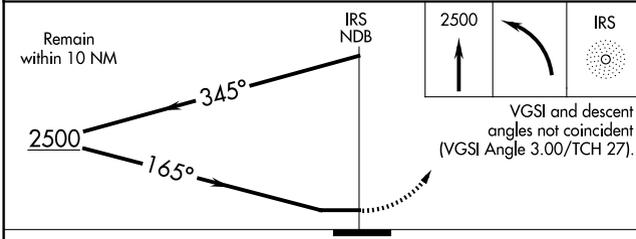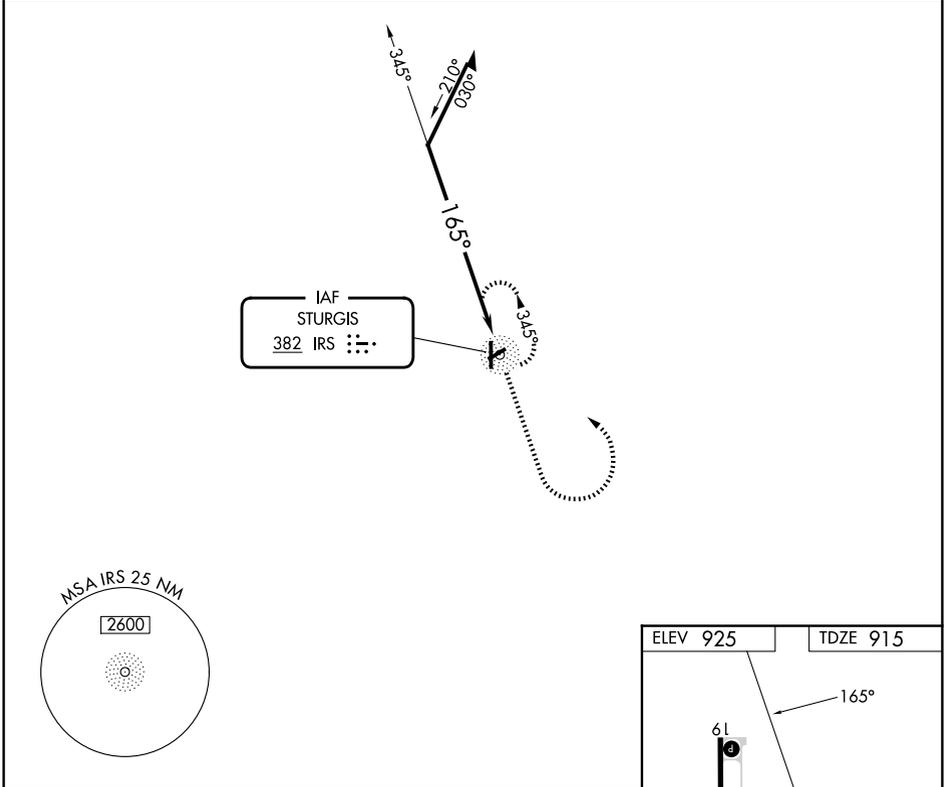

CATEGORY	A	B	C	D
S-19	1520-1	605 (600-1)	1520-1¾	605 (600-1¾)
CIRCLING	1520-1	595 (600-1)	1620-2 695 (700-2)	1620-2¼ 695 (700-2¼)