

| | | |
|--|------------------------|--|
| WAAS CH 62811 W23A | APP CRS 232° | Rwy Ldg 12103 TDZE 740 Apt Elev 744 |
|--|------------------------|--|

RNAV (GPS) RWY 23L

RICKENBACKER INTL (LCK)


RNP APCH - GPS.

▲ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. Circling NA northwest of Rwy 5L-23R. Baro-VNAV NA when using John Glenn Columbus Intl altimeter setting. When local altimeter setting not received, use John Glenn Columbus Intl altimeter setting: increase LPV DA to 975 feet; increase LNAV/VNAV DA to 1157 feet and all visibilities to RVR 4000; increase all MDAs 40 feet and LNAV visibility Cats C/D to RVR 5000 and Circling Cat D to 2 1/4 SM.
* RVR 1800 authorized with use of FD or AP or HUD to DA, (NA when using John Glenn Columbus Intl altimeter setting).



MALSRL
AS

MISSED APPROACH:
Climb to 3000 direct YERKU and hold.

| | | | |
|-----------------------|--|-----------------------------------|---------------------------------|
| ATIS 132.75 | COLUMBUS APP CON 134.0 279.6 | RICK TOWER 120.05 348.4 | GND CON 125.275 275.8 |
|-----------------------|--|-----------------------------------|---------------------------------|

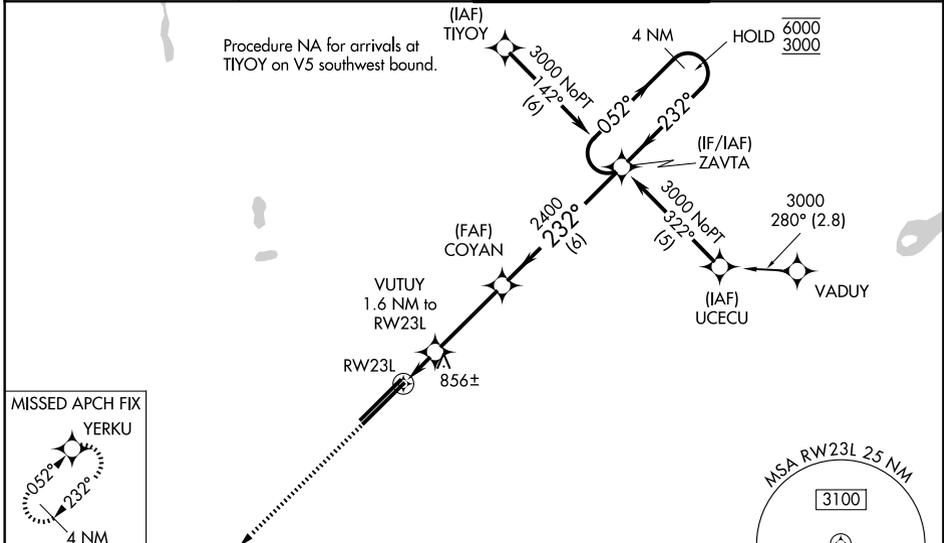

| | | |
|-----------------|----------|-----------------|
| ELEV 744 | D | TDZE 740 |
|-----------------|----------|-----------------|

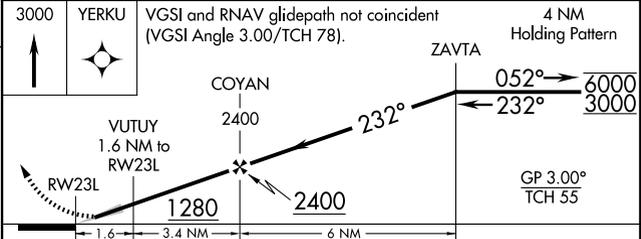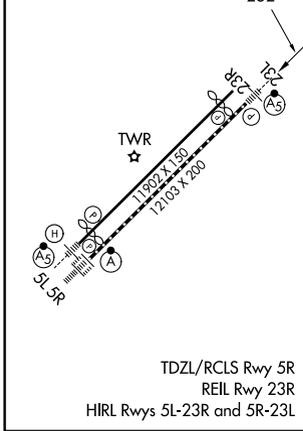

| CATEGORY | A | B | C | D |
|--------------|-----------------------|---|---|---|
| LPV DA * | 940/24 | | 200 (200-1/2) | |
| LNAV/VNAV DA | 1122/35 | | 382 (400-3/4) | |
| LNAV MDA | 1180/24 440 (500-1/2) | | 1180/40 440 (500-3/4) | |
| CIRCLING | 1240-1 496 (500-1) | | 1280-1 1/2 536 (600-1 1/2) 1400-2 656 (700-2) | |

EC-2, 19 FEB 2026 to 19 MAR 2026

EC-2, 19 FEB 2026 to 19 MAR 2026