


WAAS CH 78022 W05B	APP CRS 052°	Rwy Ldg 11004 TDZE 744 Apt Elev 744
--	------------------------	--

RNAV (GPS) RWY 5L


RICKENBACKER INTL (LCK)

RNP APCH - GPS.	MALSR 	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
-----------------	-----------	---


ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8
-----------------------	--	-----------------------------------	---------------------------------

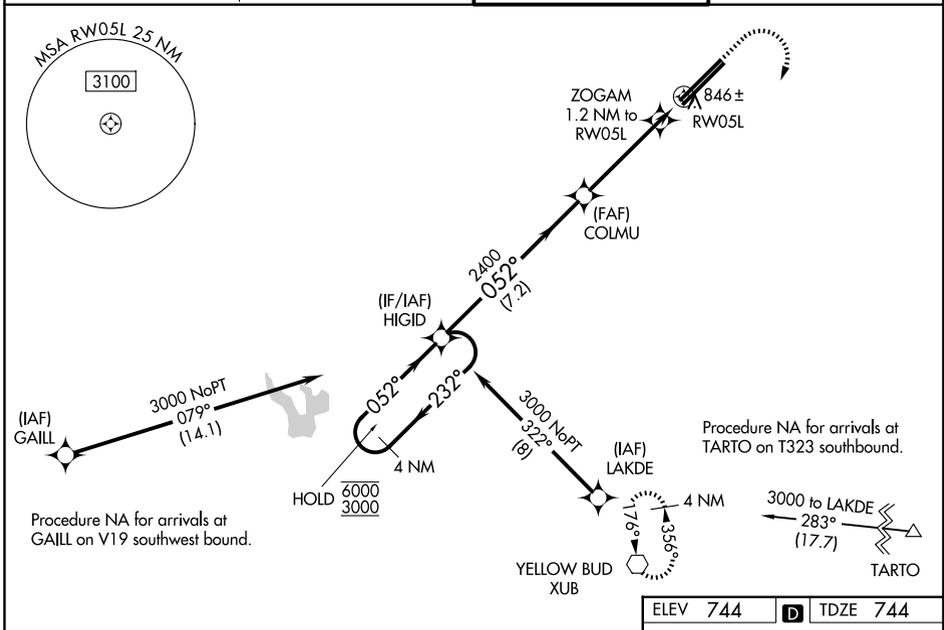

4 NM Holding Pattern
VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).

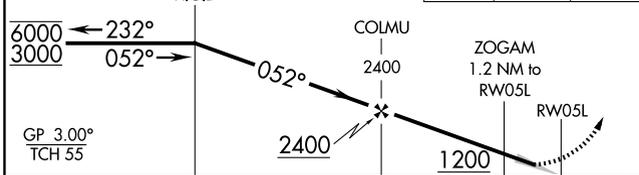

CATEGORY	A	B	C	D
LPV DA		944-1/2	200 (200-1/2)	
LNAV/VNAV DA		1007-1/2	263 (300-1/2)	
LNAV MDA	1100-1/2	356 (400-1/2)	1100-5/8	356 (400-5/8)
CIRCLING	1240-1	496 (500-1)	1280-1 1/2 536 (600-1 1/2)	1400-2 656 (700-2)

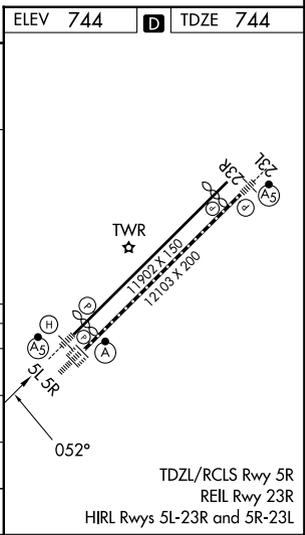

EC-2, 19 FEB 2026 to 19 MAR 2026

EC-2, 19 FEB 2026 to 19 MAR 2026