


WAAS CH 58041 W11A	APP CRS 111°	Rwy Idg 3200 TDZE 29 Apt Elev 29
--	------------------------	---

RNAV (GPS) RWY 11

BUCKLAND (BVK)(PABL)

RNP APCH.	MISSED APPROACH: Climb to 3100 direct JAMUR and hold, continue climb-in-hold to 3100.
▼ Baro-VNAV and VDP NA when using Selawik altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -21°C or above 54°C. ▲ When local altimeter setting is not received use Selawik altimeter setting: increase DA to 387 feet and all visibilities $\frac{3}{8}$ SM; increase all MDAs 120 feet and visibility Cat C $\frac{1}{4}$ SM.	

AWOS-3P 135.15	ANCHORAGE CENTER 119.2 263.0	KOTZEBUE RADIO 122.3	CTAF 122.9 0
--------------------------	--	--------------------------------	------------------------

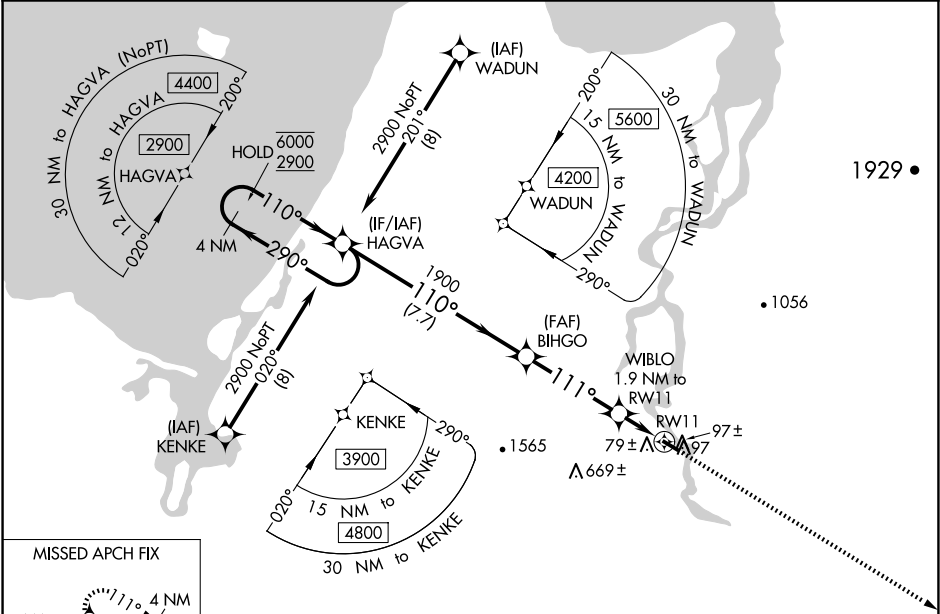

MISSED APCH FIX		ELEV 29		TDZE 29	
4 NM Holding Pattern		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 25).		3100 JAMUR	
6000 ← 290°		BIHGO 1900		*LNNAV only.	
2900 → 110°		WIBLO 1.9 NM to RW11		*0.9 NM to RW11	
GP 3.00°		1900		*660	
TCH 30		7.7 NM		3.9 NM	
		1 NM		0.9	
CATEGORY	A	B	C	D	
LPV DA	279-1	250 (300-1)		NA	
LNNAV/VNAV DA	279-1	250 (300-1)		NA	
LNNAV MDA	340-1	311 (400-1)		NA	
CIRCLING	540-1	511 (600-1)	640-1 3/4 611 (700-1 3/4)	NA	
MRL Rwy 11-29 0					