

WAAS CH 70630 W30A	APP CRS 293°	Rwy Idg TDZE Apt Elev	4300 918 918
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 30

MOORHEAD MUNI/FLORENCE KLINGENSMITH FLD (JKJ)


⚠

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C (4°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. When local altimeter setting not received, use Hector Intl altimeter setting and increase all DA 21 feet, increase all MDA 40 feet.

MISSED APPROACH:

Climb to 1700 then climbing right turn to 3600 direct IVEJE and hold.

AWOS-3 120.0	FARGO APP CON 120.4 377.15	GCO 121.725	UNICOM 123.0 (CTAF) 0
------------------------	--------------------------------------	-----------------------	--

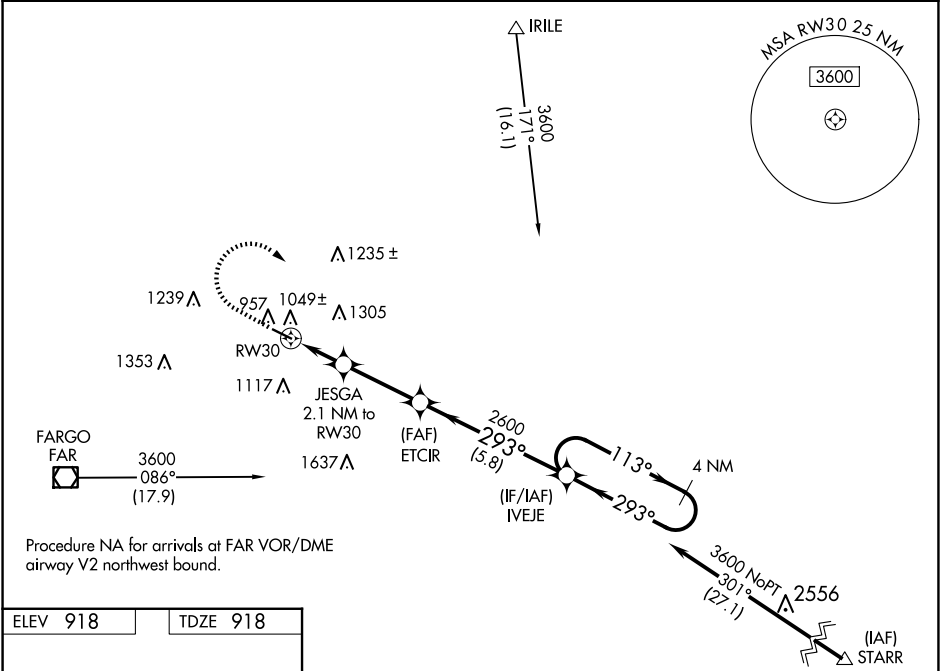

ELEV 918

TDZE 918

REIL Rwy 12 and 30 **0**

MIRL Rwy 12-30 **0**

1700	3600	IVEJE	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 25).	IVEJE	4 NM Holding Pattern
*LNAV only	JESGA 2.1 NM to RW30	ETCIR	2600	293°	113° → 3600
	1.1 NM to RW30		1620*	2600	GP 3.00° TCH 40
	1.1 NM	1 NM	3.1 NM	5.8 NM	
CATEGORY	A	B	C	D	
LPV DA	1168-1	250 (300-1)	NA	NA	
LNAV/VNAV DA	1211-1	293 (300-1)	NA	NA	
LNAV MDA	1300-1	382 (400-1)	NA	NA	
CIRCLING	1360-1 442 (500-1)	1380-1 462 (500-1)	NA	NA	