


LOC/DME I-CMH 111.75 Chan 54 (Y)	APP CRS 281°	Rwy Ldg 10114 TDZE 815 Apt Elev 815
------------------------------------------------------	------------------------	----------------------------------------------------------------

ILS or LOC RWY 28L



JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required. ▼ Simultaneous approach authorized. ▲ For inop ALS, increase S-LOC 28L Cat C/D visibility to 1 3/8 SM.	MALSR 	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.
---------------------------------------------------------------------------------------------------------------------------------------------------	-----------	----------------------------------------------------------------------------------------

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6
------------------------	-------------------------------------------	--------------------------------------	-------------------------------

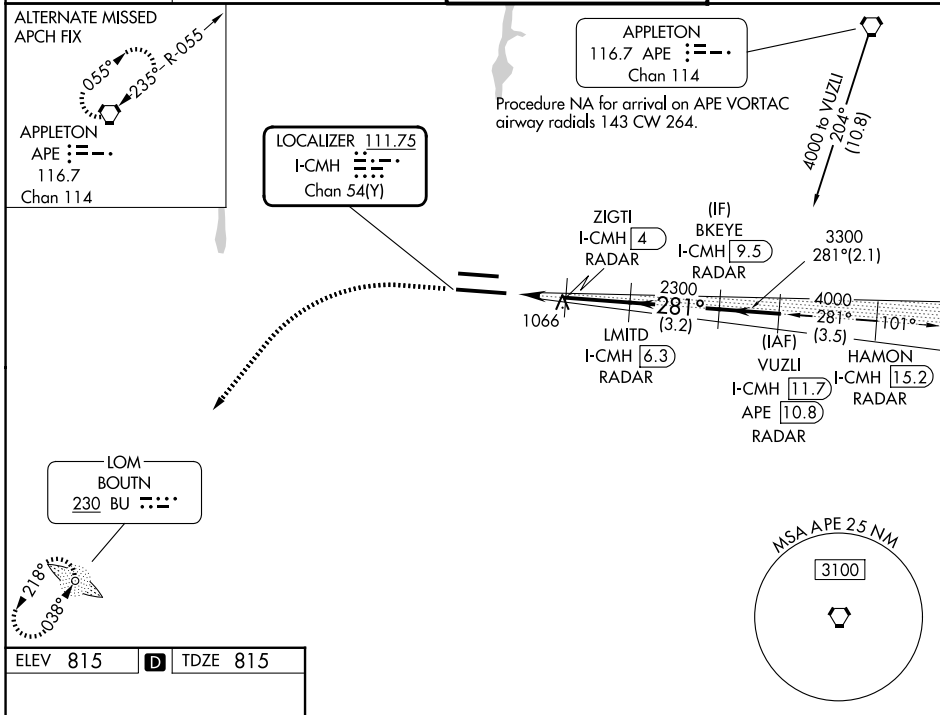

ELEV 815	D	TDZE 815
-----------------	----------	-----------------

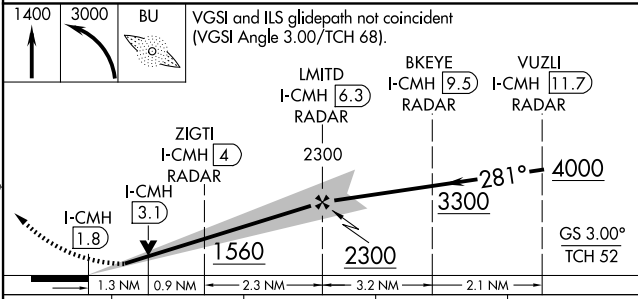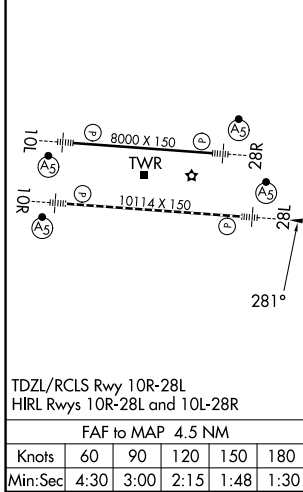

CATEGORY	A	B	C	D
S-ILS 28L	1015/18 200 (200-1/2)			
S-LOC 28L	1300/24	485 (500-1/2)	1300/50	485 (500-1)
CIRCLING	1340-1 525 (600-1)		1520-2 705 (800-2)	1520-2 1/4 705 (800-2 1/4)

EC-2, 16 APR 2026 to 14 MAY 2026

EC-2, 16 APR 2026 to 14 MAY 2026