


LOC/DME I-ONB 109.1 Chan 28	APP CRS 281°	Rwy Ldg TDZE Apt Elev	8000 813 815
--	------------------------	-----------------------------	---


ILS or LOC RWY 28R

JOHN GLENN COLUMBUS INTL (CMH)

DME or RADAR required.		MALSR	MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct APE VORTAC and hold.
<p>Simultaneous approach authorized. Autopilot coupled approach NA.</p> <p>For inop ALS, increase S-LOC 28R Cat C/D visibility to 1 3/8 SM.</p>			
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6

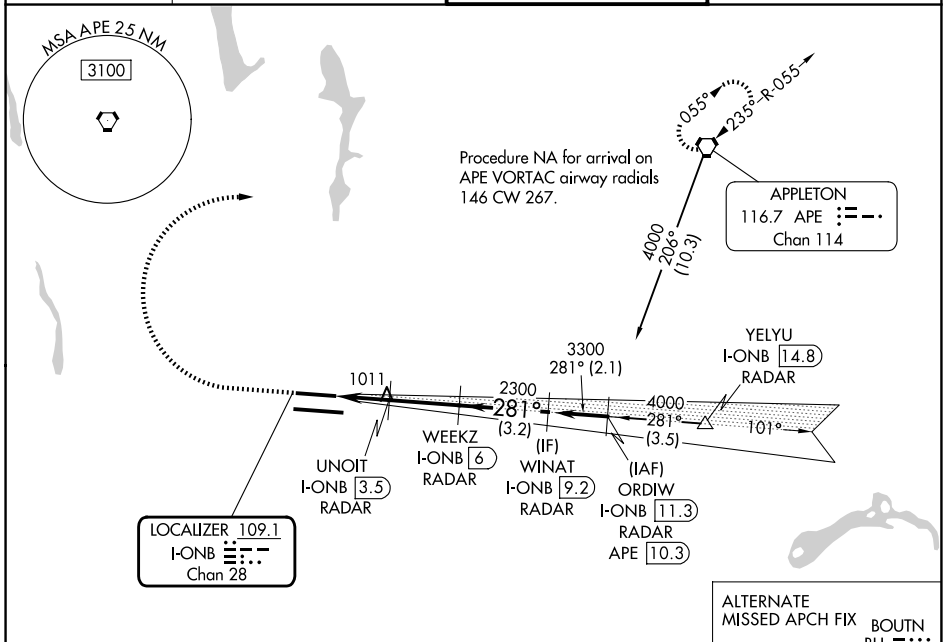

ELEV 815	D	TDZE 813
----------	---	----------

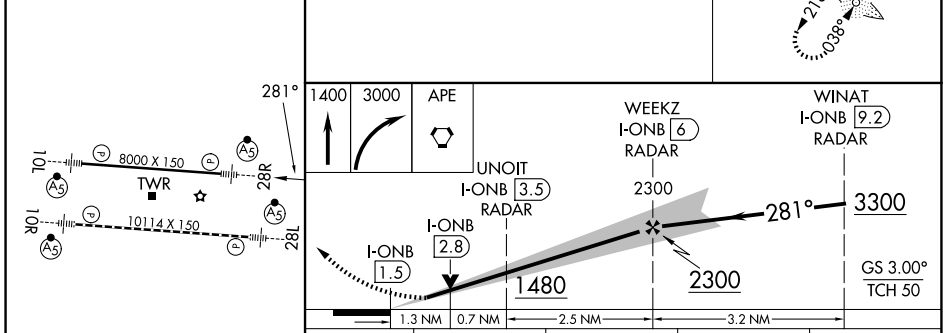

TDZL/RCLS Rwy 10R-28L					
HIRL Rwys 10R-28L and 10L-28R					
FAF to MAP 4.5 NM					
Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30
CATEGORY	A	B	C	D	
S-ILS 28R	1013/24 200 (200-1/2)				
S-LOC 28R	1280/24	467 (500-1/2)	1280/50	467 (500-1)	
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 1/4 705 (800-2 1/4)	

EC-2, 16 APR 2026 to 14 MAY 2026

EC-2, 16 APR 2026 to 14 MAY 2026