



LOC/DME I-AKN	APP CRS	Rwy Ldg	8501
110.3	301°	TDZE	73
Chan 40		Apt Elev	73

LOC BC RWY 30

KING SALMON (AKN)(PAKN)

DME required.	MISSED APPROACH: Climb to 600 then climbing left turn to 3000 on heading 240° and AKN VORTAC R-210 to OLLER/AKN 15 DME and hold.
When local altimeter setting not received, use WSN/PFWs altimeter setting and increase all MDAs 40 feet.	

ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	KING SALMON TOWER* 118.3 279.5	GND CON 121.9	UNICOM 122.95	CTAF 121.9 352.05
----------------------	--	--	-------------------------	-------------------------	-----------------------------

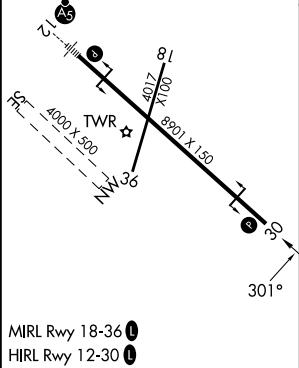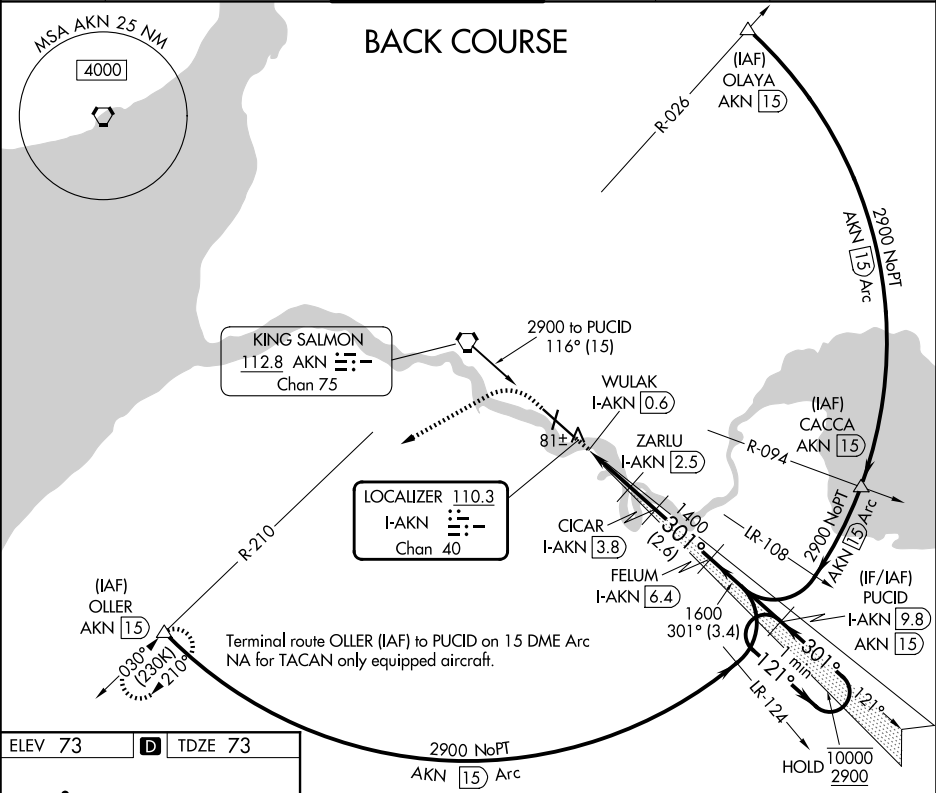

600	3000	OLLER	Disregard GS indications.	PUCID	One Minute Holding Pattern
↑	hdg 240°	AKN R-210		I-AKN [9.8]	
		ZARLU I-AKN [2.5]	FELUM I-AKN [6.4]		
		WULAK I-AKN [0.6]	CICAR I-AKN [3.8]		
		≤ 3.10°			
		TCH 45			
		1000	1400	1600	10000
		0.7	2 NM	1.2 NM	2.6 NM
					3.4 NM
CATEGORY	A	B	C	D	E
S-30			340-1	267 (300-1)	
CIRCLING	580-1	507 (600-1)	580-1½	900-2¾	960-3
			507 (600-1½)	827 (900-2¾)	887 (900-3)