

YIGO, GUAM I, GUAM

TACAN Y RWY 24L

VORTAC UNZ 115.8 Chan T05	APCH CRS 236°	Rwy ldg TDZE Arpt Elev	11,199 607 617
---------------------------------	------------------	------------------------------	----------------------

(USAF)

ANDERSEN AFB (PGUA)


⚠ *When ALS inop increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.
** Circling not authorized NW of Rwy 06L-24R.

MISSED APPROACH: Climb to 3000 direct CCOOK, then climbing left turn to intercept UNZ R-056 and hold.


ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

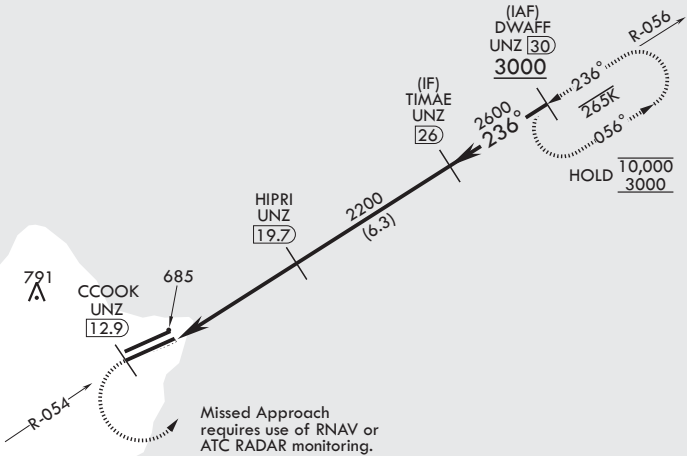


NIMITZ
115.8 UNZ
Chan 105

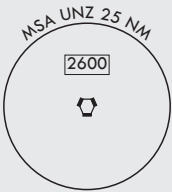

EMERG SAFE ALT 100 NM 2900

3000	CCOOK UNZ 12.9	UNZ R-056	DWAFF UNZ 30	ELEV 617	TDZE 607
VORTAC	WEVUS 14.8	15.6	HIPRI 19.7	TIMAE 26	236°
			2200	2600	3000
				≤ 2.94° TCH 43	
CATEGORY	A	B	C	D	E
S-24L*	940/40	333 (400-¾)	940/45	333 (400-¾)	
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¼ 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)
					HIRL all rwys

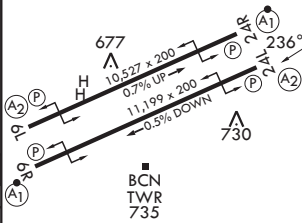

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 2 17JUN21
TERPS

TACAN Y RWY 24L