

YIGO, GUAM I, GUAM

TACAN Z RWY 06L


TACAN UAM Chan 54	APCH CRS 065°	Rwy Idg TDZE Arprt Elev	10,527 539 617
----------------------	------------------	-------------------------------	----------------------

(USAF)

ANDERSEN AFB (PGUA)

RADAR or DME required	SALS A2	MISSED APPROACH: Climb to 3000, intercept UAM R-051 to FOVEM and hold.
* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis 1 3/8 miles. ** Circling not authorized NW of Rwy 06L-24R.		

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

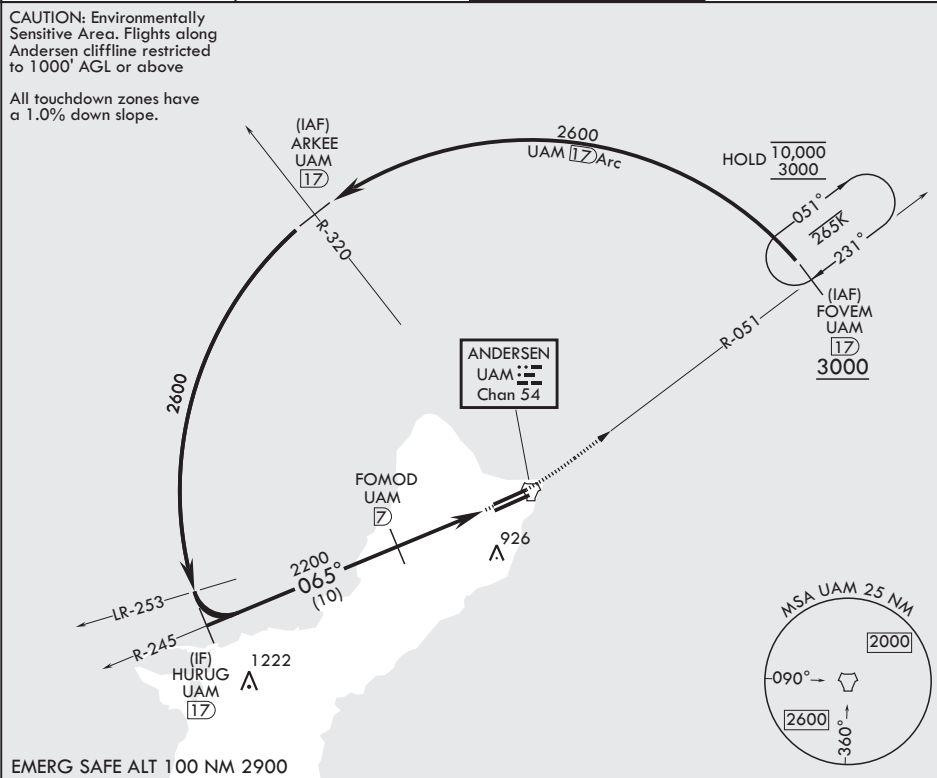

HURUG UAM 17	2600	065°	FOMOD UAM 7	2200	2.97° ≥ TCH 60	ITUME 2.5	TACAN	3000 UAM R-051	FOVEM UAM 17	ELEV 617	TDZE 539
CATEGORY	A	B	C	D	E						
S-6L*	1040/40	501 (500-¾)	1040-1¼	501 (500-1¼)							
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¼ 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)						
HIRL all rwys											

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 3 30NOV23
TERPS

TACAN Z RWY 06L