


| | | | |
|--|------------------------|-----------------------------|---|
| WAAS CH 61237 W28A | APP CRS 261° | Rwy Ldg TDZE Apt Elev | 7000 257 257 |
|--|------------------------|-----------------------------|---|

RNAV (GPS) Y RWY 28L

MONTEREY RGNL (MRY)

⚠ Circling NA South of Rwy 28L-10R. DME/DME RNP-0.3 NA.
⚠ Helicopter visibility reduction below RVR 4000 NA.
 MISSED APPROACH: Climbing right turn to 6000 direct SNS VORTAC and hold, continue climb-in-hold to 6000.

| | | | | |
|-----------------------|--|--|---------------------------------|-------------------------|
| ATIS 119.25 | NORCAL APP CON 133.0 251.15 (001°-135°) 127.15 307.125 (136°-360°) | MONTEREY TOWER ★ 118.4 (CTAF) 0 257.8 | GND CON 120.875 348.6 | UNICOM 122.95 |
|-----------------------|--|--|---------------------------------|-------------------------|

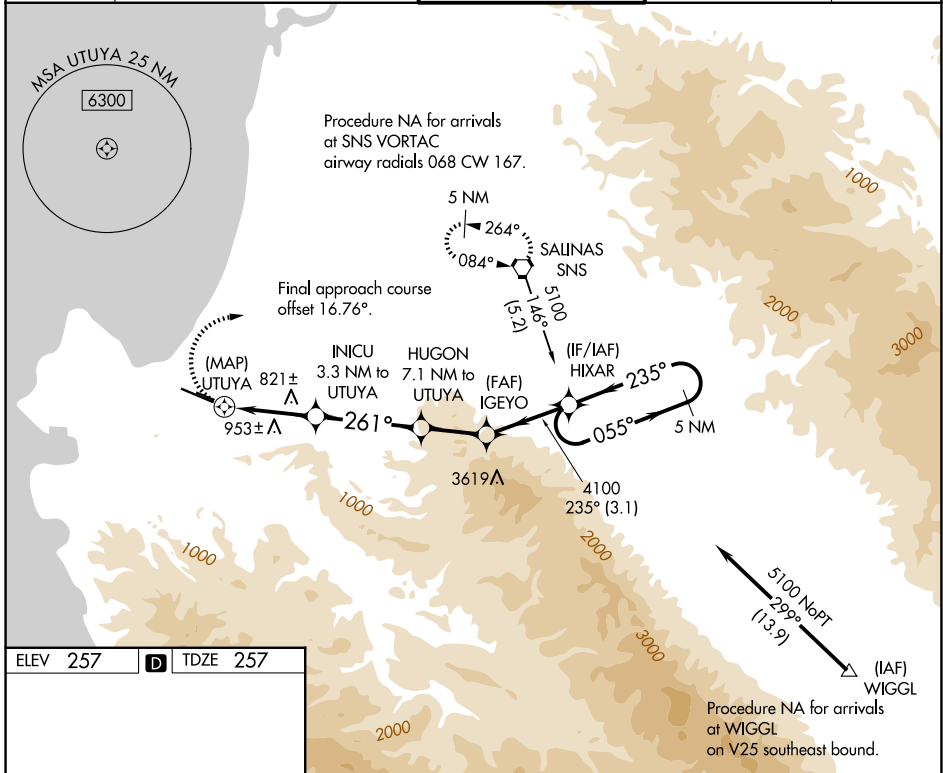

| | | | | |
|-----------------|------------------------|-------------------------|----------------------------|----|
| ELEV 257 | D | TDZE 257 | | |
| | | | | |
| 6000 SNS | INICU 3.3 NM to UTUYA | HUGON 7.1 NM to UTUYA | HIXAR 5 NM Holding Pattern | |
| 1.6 NM to UTUYA | UTUYA | IGEYO 3.60° TCH 47 | 4100 | |
| 0.4 | 1.6 | 1.7 NM | 3.8 NM | |
| 2.4 NM | 3.1 NM | | | |
| CATEGORY | A | B | C | D |
| LP MDA | 1080/55 823 (900-1) | 1080/60 823 (900-1¼) | 1080-2½ 823 (900-2½) | NA |
| LNAV MDA | 1120/55 863 (900-1) | 1120/60 863 (900-1¼) | 1120-2½ 863 (900-2½) | NA |
| CIRCLING | 1120-1¼ | 863 (900-1¼) | 1260-3 1003 (1100-3) | NA |