

LOC/DME I-AQI <b>111.75</b> Chan 54 (Y)	APP CRS <b>101°</b>	Rwy Ldg <b>10114</b> TDZE <b>809</b> Apt Elev <b>815</b>
---	------------------------	--

# ILS or LOC RWY 10R

JOHN GLENN COLUMBUS INTL (CMH)


ADF required. DME or RADAR required.

Simultaneous approach authorized.



MALSR

MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.

D-ATIS <b>124.6</b>	COLUMBUS APP CON <b>125.95 371.975</b>	COLUMBUS TOWER <b>132.7 257.8</b>	GND CON <b>121.9 348.6</b>
------------------------	---	--------------------------------------	-------------------------------

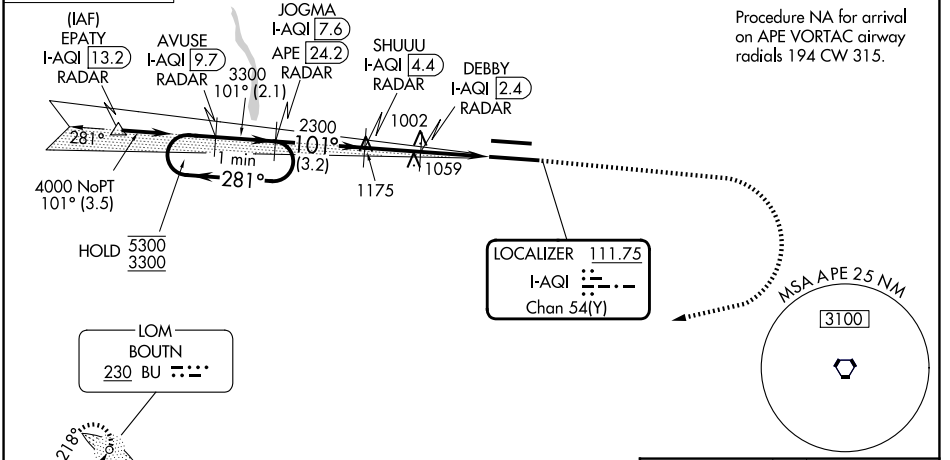

ELEV 815	<b>D</b> TDZE 809
----------	-------------------

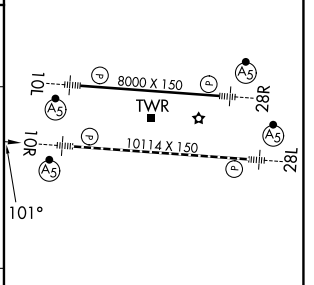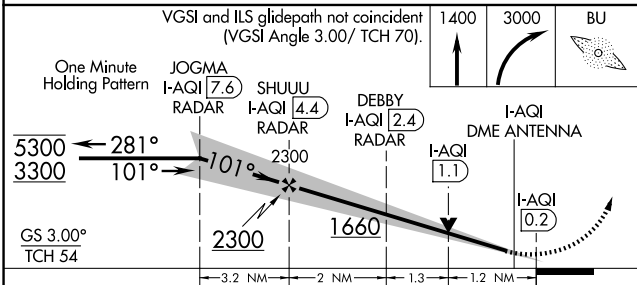

CATEGORY	A	B	C	D
S-ILS 10R	1009/18		200 (200-½)	
S-LOC 10R	1260/24	451 (500-½)	1260/45	451 (500-¾)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 ¼ 705 (800-2 ¼)

TDZL/RCLS Rwy 10R-28L					
HIRL Rwys 10R-28L and 10L-28R					
FAF to MAP 4.5 NM					
Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30

EC-2, 11 JUN 2026 to 09 JUL 2026

EC-2, 11 JUN 2026 to 09 JUL 2026