

SHEMYA, ALASKA

VOR/DME or TACAN RWY 10

VORTAC SYA 109.0 Chan 27	APCH CRS 092°	Rwy Idg 10,004 TDZE 98 Arpt Elev 98
--------------------------------	------------------	---

[USAF]

EARECKSON AS (SYA) (PASY)


* When ALS inop, increase CAT AB vis to 1½ miles;
CAT CDE vis to 1½ miles.
** Circling not authorized N of Rwy 10-28.



MISSED APPROACH: Climb to 1200, then climbing right turn to 4200, intercept SYA R-272 direct EMLAW and hold.

ANCHORAGE CENTER 119.1 339.8	CTAF 127.2 352.05
---------------------------------	----------------------

CAUTION: Numerous obstructions in area N of Rwy 10-28.
Missed approach requires use of RNAV or ATC RADAR monitoring.

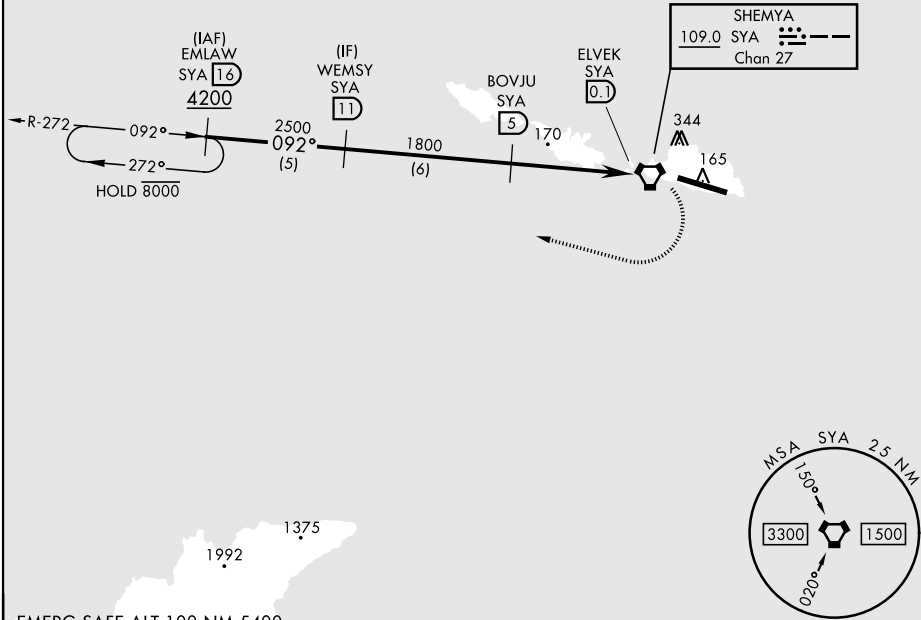

EMERG SAFE ALT 100 NM 5400

WEMS SYA (11) 2500 092° 1800 2.56° TCH 46 4.9 NM 1.2 NM SYA VORTAC SYA ELVEK SYA (0.8) (0.1) 1200 4200 EMLAW R-272 (16)						ELEV 98	TDZE 98
CATEGORY	A	B	C	D	E	101 (P) 092° 10,004 x 150 TWY (P) 28 (A1) (A2)	
S-10 *	640-1	542 (600-1)	640-1½ 542 (600-1½)				
CIRCLING **	640-1½	542 (600-1½)	640-1½ 542 (600-1½)	660-2 562 (600-2)	680-2 582 (600-2)		
						HIRL Rwy 10-28 1 REIL Rwy 10 and 28	

SHEMYA, ALASKA

52°43'N-174°07'E

EARECKSON AS (SYA) (PASY)

Amtd 7 05SEP24

VOR/DME or TACAN RWY 10

AK, 14 MAY 2026 to 09 JUL 2026

AK, 14 MAY 2026 to 09 JUL 2026