

YIGO, GUAM I, GUAM

TACAN Z RWY 24R


|                      |                  |                               |                      |
|----------------------|------------------|-------------------------------|----------------------|
| TACAN UAM<br>Chan 54 | APCH CRS<br>231° | Rwy Idg<br>TDZE<br>Arprt Elev | 10,527<br>617<br>617 |
|----------------------|------------------|-------------------------------|----------------------|

(USAF)

ANDERSEN AFB (PGUA)

|                                                                                                                                               |        |                                                                                                           |
|-----------------------------------------------------------------------------------------------------------------------------------------------|--------|-----------------------------------------------------------------------------------------------------------|
| RADAR or DME required                                                                                                                         | ALSF-1 | MISSED APPROACH: Climb to 1100, then climbing left turn to 3000 to intercept UAM R-051 to FOVEM and hold. |
| * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.<br>** Circling not authorized NW of Rwy 06L-24R. |        |                                                                                                           |

|                         |                                     |                      |                        |
|-------------------------|-------------------------------------|----------------------|------------------------|
| ATIS<br>118.175 254.325 | GUAM APP CON/DEP CON<br>119.8 269.0 | TOWER<br>126.2 233.7 | GND CON<br>121.7 275.8 |
|-------------------------|-------------------------------------|----------------------|------------------------|

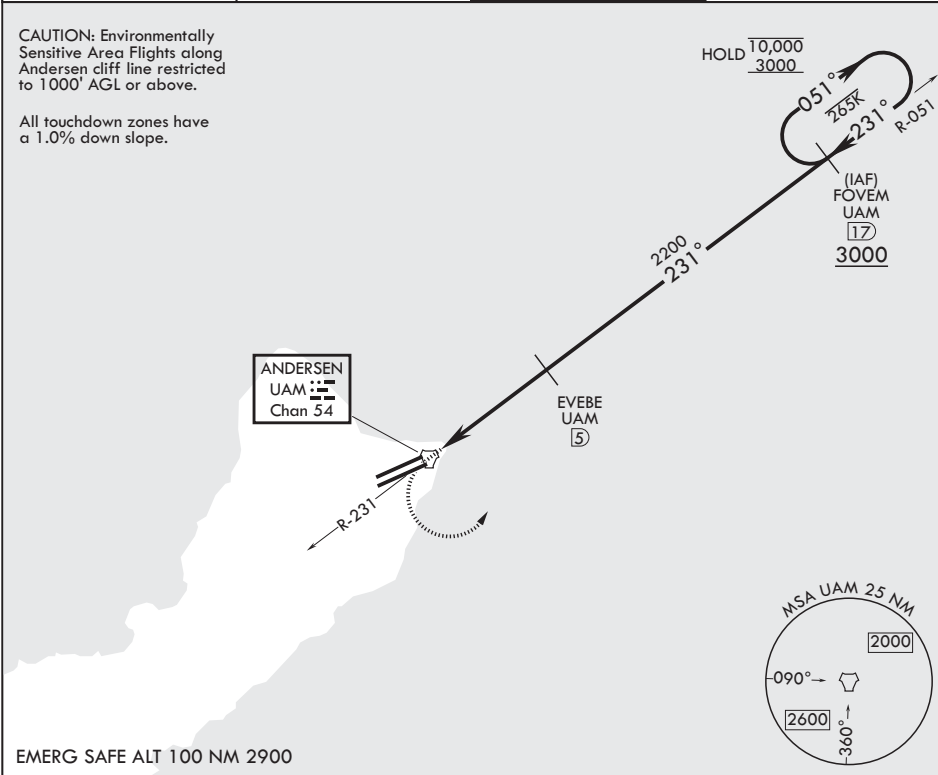

|                   |                      |                                                                 |                      |                    |                      |
|-------------------|----------------------|-----------------------------------------------------------------|----------------------|--------------------|----------------------|
| 1100<br>UAM R-051 | 3000<br>FOVEM UAM 17 | VGSI and ILS glidepath not coincident (VGSI angle 3.00/TCH 59). | FOVEM 17             | ELEV 617           | TDZE 617             |
|                   |                      |                                                                 |                      |                    |                      |
| CATEGORY          | A                    | B                                                               | C                    | D                  | E                    |
| S-24R*            | 940/24 323 (400-½)   | 940/40 323 (400-¾)                                              | 1240-1¼ 623 (700-1¼) | 1240-2 623 (700-2) | 1240-2¼ 623 (700-2¼) |
| CIRCLING**        | 1060-1 443 (500-1)   | 1080-1 463 (500-1)                                              | 1240-1¼ 623 (700-1¼) | 1240-2 623 (700-2) | 1240-2¼ 623 (700-2¼) |
| HIRL all rwys     |                      |                                                                 |                      |                    |                      |

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 2 17JUN21  
TERPS

TACAN Z RWY 24R

PAC, 14 MAY 2026 to 09 JUL 2026

PAC, 14 MAY 2026 to 09 JUL 2026