



LOC/DME I-HFW 109.3 Chan 30	APP CRS 095°	Rwy Ldg TDZE Apt Elev 8800 1015 1026
---	------------------------	--

ILS RWY 8L (SA CAT I)
HARTSFIELD/JACKSON ATLANTA INTL (ATL)

RADAR required for procedure entry. DME or RADAR required.		ALSIF-2	MISSED APPROACH: Climb to 1500 then climbing left turn to 3500 on heading 360° and RMG VORTAC R-115 to TROYS/RMG 38.1 DME/RADAR and hold.
Simultaneous approach authorized. Requires specific OPSPEC, MSPEC, or LOA approval.			
D-ATIS 119.65	ATLANTA APP CON 134.725 379.9	ATLANTA TOWER 8L-26R 8R-26L 9L-27R 9R-27L 10-28 RWYS 119.1 125.325 123.85 119.3 119.5 254.4	ALL RWYS (8L-26R,8R-26L) (9L-27R,9R-27L) 10-28 121.9 121.75 121.65 254.4

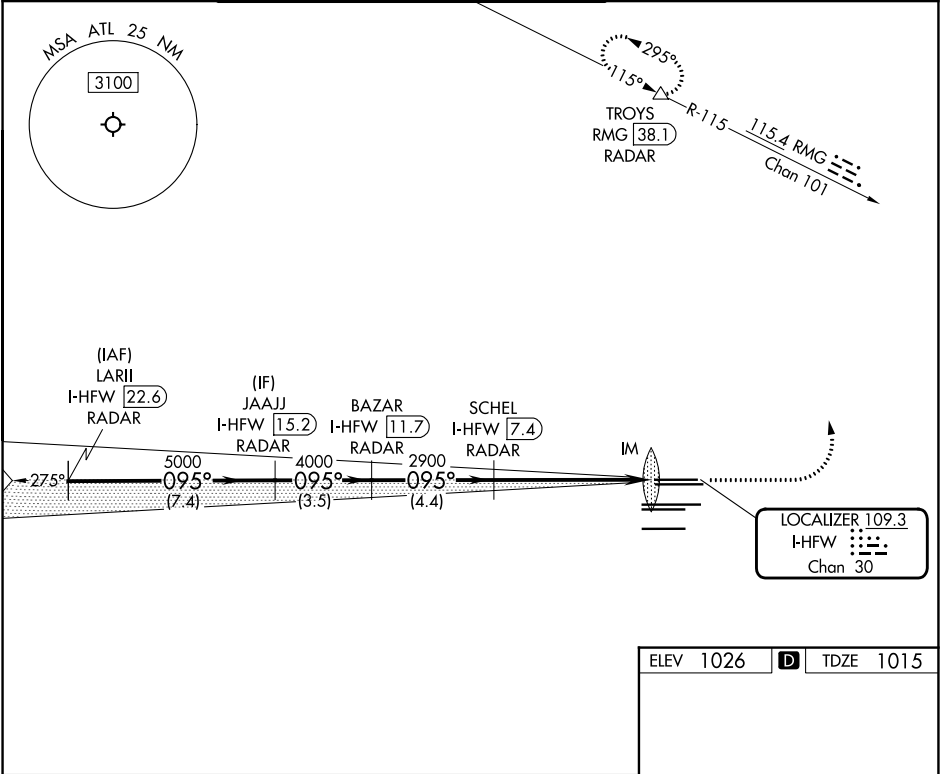

ELEV 1026	D	TDZE 1015
-----------	----------	-----------

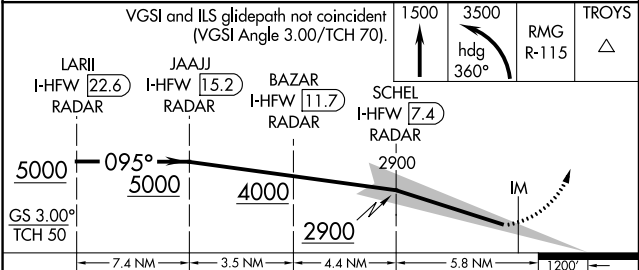

CATEGORY	A	B	C	D
S-ILS 8L	RA 147/14	150	DA 1165	
SA CATEGORY I ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED				

