

APP CRS	Rwy Ldg	7569
055°	TDZE	708
	Apt Elev	727

RNAV (RNP) Z RWY 5



BUFFALO NIAGARA INTL (BUF)

⚠ For uncompensated Baro-VNAV systems, procedure NA below -18°C (0°F) or above 54°C (130°F). GPS required. For inoperative MALSR, increase RNP 0.10 all Cats visibility to 1¼. For inoperative MALSR, increase RNP 0.30 all Cats visibility to 1½.

MALSR

MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to TRAVA and hold.

D-ATIS	BUFFALO APP CON	BUFFALO TOWER	GND CON
135.35	126.15 263.125	120.5 257.8	133.2 257.8

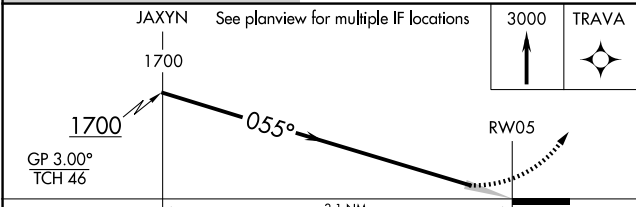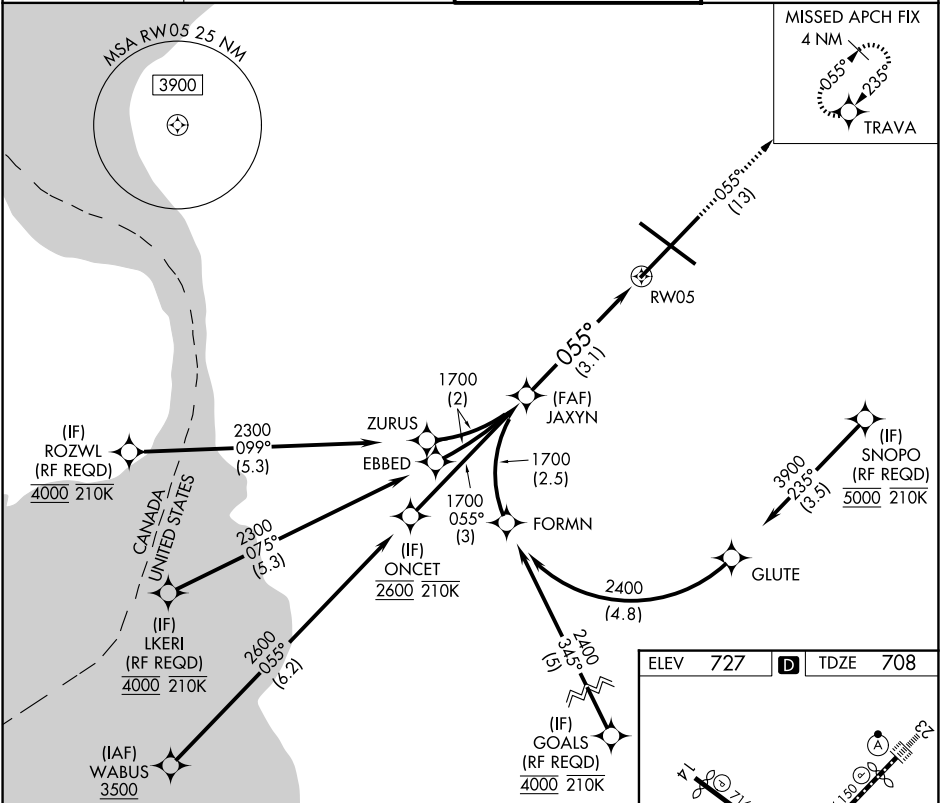

CATEGORY	A	B	C	D
RNP 0.10 DA	1065/45 357 (400-¾)			
RNP 0.30 DA	1159/60 451 (500-1¼)			

ELEV 727 **D** TDZE 708

14 055°

2161 X 150

8829 X 150

32 055°

TWR

32

REIL Rwy 14

TDZL/RCLS Rwy 5 and 23

HIRL Rwy 5-23 and 14-32

AUTHORIZATION REQUIRED

NE-2, 09 JUL 2026 to 06 AUG 2026

NE-2, 09 JUL 2026 to 06 AUG 2026