

APP CRS	Rwy Ldg	10900
061°	TDZE	998
	Apt Elev	1009

RNAV (RNP) Y RWY 6L


JAMES M COX DAYTON INTL (DAY)

GPS required. For uncompensated Baro-VNAV systems, procedure NA below -19°C (-2°F) or above 54°C (130°F). For inop ALS, increase RNP 0.10 all Cats visibility to RVR 6000. For inop ALS, increase RNP 0.30 all Cats visibility to 1 ½.

ALSIF-2

MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to BONEE and hold.

ATIS	COLUMBUS APP CON	DAYTON TOWER	GND CON
125.8	118.85 305.2 (091°-180°) 134.45 323.15 (181°-090°)	119.9 257.7	121.9

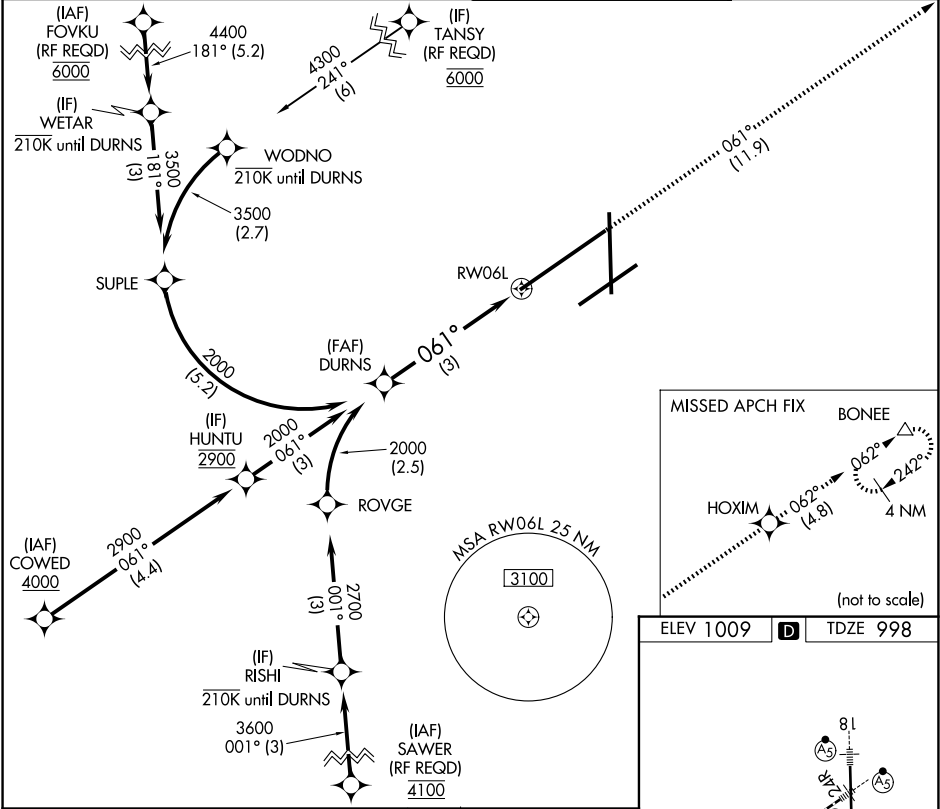

VGSI and RNAV glidepath not coincident DURNS (VGSI Angle 3.00/TCH 67).

GP 3.00° TCH 51

See planview for multiple IF locations.

3000 tr 061°

HOXIM tr 062°

BONEE

2000

061°

RW06L

3 NM

CATEGORY

A

B

C

D

RNP 0.10 DA

1358/40

360 (400-¾)

RNP 0.30 DA

1464/60

466 (500-1½)

AUTHORIZATION REQUIRED

HIRL all Rwys

TDZL/RCLS Rwy 6L

REIL Rwys 6R and 36

EC-2, 09 JUL 2026 to 06 AUG 2026

EC-2, 09 JUL 2026 to 06 AUG 2026