

ILS RWY 5L (SA CAT I)
INDIANAPOLIS INTL (IND)

MISSED APPROACH: Climb to 1700 then climbing left turn to 3000 direct VHP VORTAC then on VHP VORTAC R-303 to KEADY/VHP 4.9 DME/RADAR and hold.

MISSED APCH FIX

R-303
123°
303°
116.3 VHP
Chan 110

KEDDY
VHP [4.9]
RADAR

OINKK INT
I-IND [6.1]
RADAR

STDUM
I-IND [9]
RADAR

(IF)
FTBLI
I-IND [12.1]
RADAR

(IAF)
WAAYN
I-IND [15.2]
RADAR
210K

5000 to WAAYN
004° (0.9) and
LOC (10.1)

(IAF)
KELLY
VHP [27.9]

(CFVDC)

Procedure NA for arrivals at
KELLY on V11 southwest bound
and V12 westbound.

RADAR or DME REQUIRED

MSA VHP 25 NM
[3100]

LOCALIZER 111.75
I-IND
Chan 54(Y)

IM
870±

ALTERNATE MISSED
APCH FIX


115.3 TTH
R-077
Chan 100

077°
257°
CLOTT
TTH [23.3]
RADAR

ELEV 796 **D** TDZE 747

CATEGORY	A	B	C	D
S-ILS 5L	RA 178/14 150 DA 897			

SA CATEGORY I ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

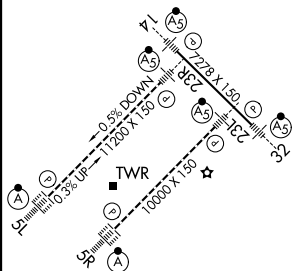

HIRL all Rwy's
TDZ/CL Rwy's 5L and 5R

EC-2, 09 JUL 2026 to 06 AUG 2026