

WAAS CH 45706 W05A	APP CRS 050°	Rwy Ldg 11200 TDZE 747 Apt Elev 796
--	------------------------	--

RNAV (GPS) Y RWY 5L

INDIANAPOLIS INTL (IND)

T
A


For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -18°C (0°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. Simultaneous approach authorized. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For inoperative ALS, increase LNAV/VNAV all Cats visibility to 1¼ SM and increase LNAV Cat C/D visibility to 1½ SM.

11050




MISSED APPROACH:
Climb to 1300 then
climbing left turn to
3000 direct KEADY
and hold.

D-ATIS 134.25	INDIANAPOLIS APP CON 128.175 317.8	INDY TOWER 120.9 251.1	GND CON 121.9	CLNC DEL 128.75 251.1	CPDLC
------------------	---------------------------------------	---------------------------	------------------	--------------------------	-------

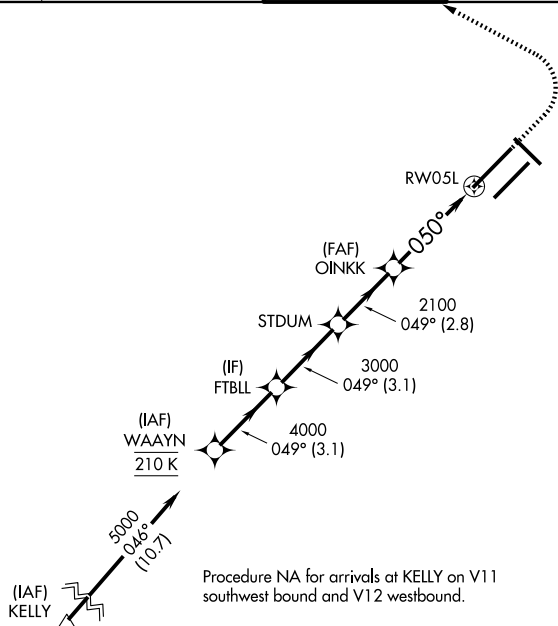

MISSED APCH FIX

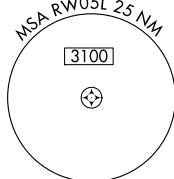

Procedure NA for arrivals at KELLY on V11 southwest bound and V12 westbound.

ELEV 796

TDZE 747

0.5% DOWN

0.5% UP

11,200 X 150

22,778 X 1,50

22,778 X 150

10,000 X 150

TWR

0.50°

HIRL all Rwy

TDZ/CL Rwy 5L and 5R

INDIANAPOLIS, INDIANA

Amdt 4A 17AUG17

INDIANAPOLIS INTL (IND)

39°43'N-86°18'W

RNAV (GPS) Y RWY 5L