



LOC/DME I-DCX 111.7 Chan 54	APP CRS 304°	Rwy Ldg TDZE Apt Elev 7913 8 9
---	------------------------	--

ILS or LOC RWY 30
MIAMI INTL (MIA)

DME required. Inop table does not apply.		MALS 	MISSED APPROACH: Climb to 800 then climbing right turn to 2000 on heading 310° and DHP VORTAC R-335 to BRBRA/11.5 DME and hold.
D-ATIS 119.15	MIAMI APP CON 124.85 322.3	MIAMI TOWER 118.3 256.9	GND CON 121.8 (8L/8R/12/26L/26R) 127.5 (9/27/30) 348.6

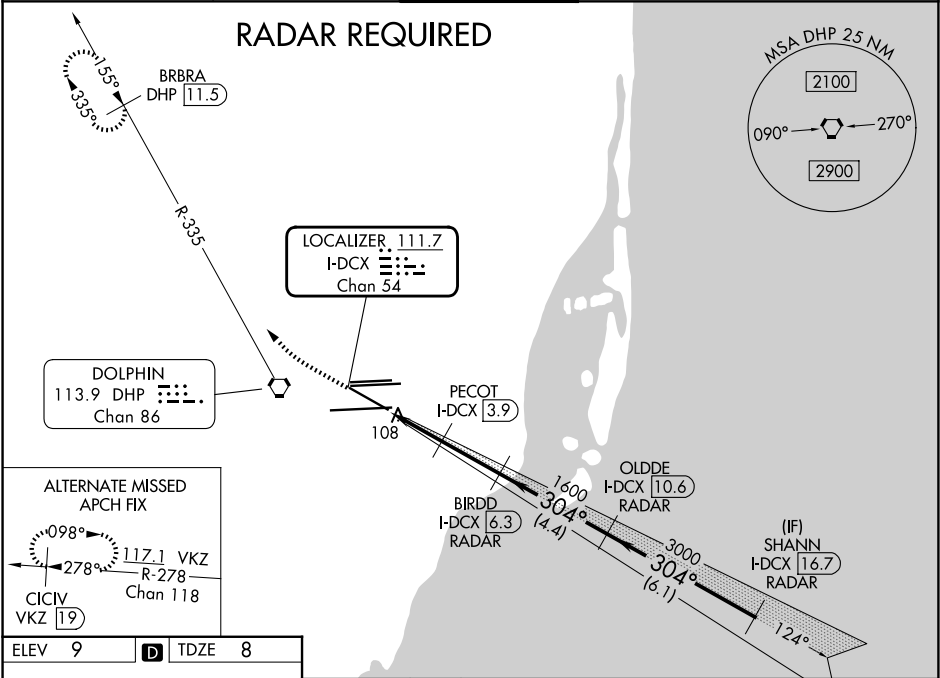

ELEV 9	D	TDZE 8
---------------	----------	---------------

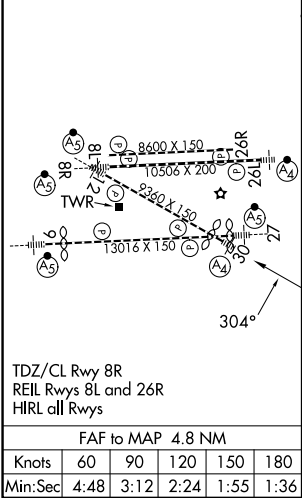

800	2000	DHP R-335	BRBRA DHP 11.5	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 71).
*LOC only.				