
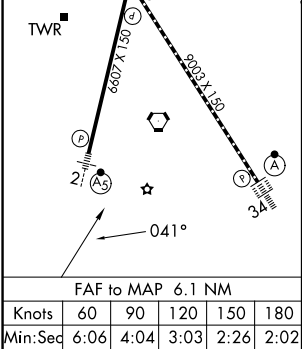


VORTAC RIC	APP CRS	Rwy Ldg	6607
114.1	041°	TDZE	162
Chan 88		Apt Elev	167

VOR RWY 2
RICHMOND INTL (RIC)

Rwy 2 helicopter visibility reduction below 3/4 SM NA. For inop ALS, increase S-2 Cat A/B visibility to 1 SM, and Cat C/D to 1 1/2 SM.	MALSR 	MISSED APPROACH: Climbing left turn to 2000 on RIC VORTAC R-018 to EPICS INT/RIC 17.3 DME and hold.
--	-----------	---

ATIS 119.15 263.025	POTOMAC APP CON 126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	RICHMOND TOWER 121.1 257.8	GND CON 121.9 348.6
------------------------	--	-------------------------------	------------------------

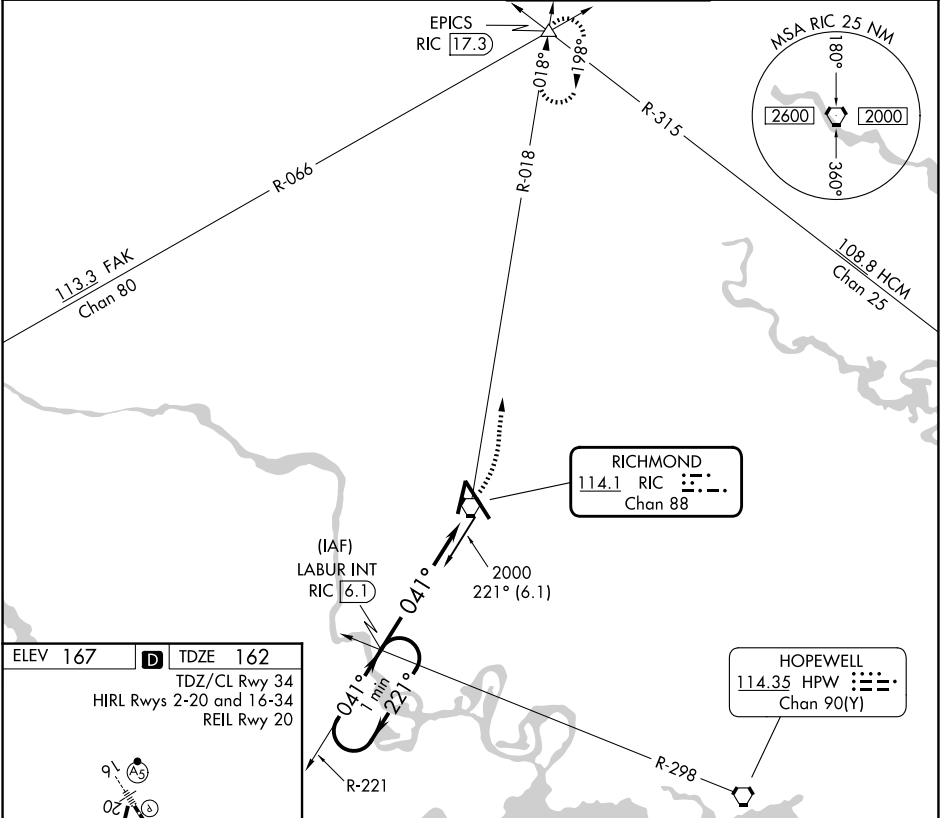

One Minute Holding Pattern		LABUR INT RIC 6.1	2000 RIC R-018	EPICS
2000 ← 221° 041° →		041°	RIC 1.7	RIC VORTAC
		2.98° TCH 49	4.3 NM	1.4
CATEGORY	A	B	C	D
S-2	640-3/4	478 (500-3/4)	640-1	478 (500-1)
CIRCLING	660-1	493 (500-1)	700-1 1/2 533 (600-1 1/2)	720-2 553 (600-2)