

LOC I-BKY 111.5	APP CRS 303°	Rwy Ldg 10679 TDZE 583 Apt Elev 617
---------------------------	------------------------	--

ILS or LOC RWY 30L
ST LOUIS LAMBERT INTL (STL)


▼ For inop ALS, increase S-ILS 30L Cat E visibility to RVR 4000 and S-LOC 30L Cat A/B visibility to RVR 5500 and cat C/D/E visibility to 1 $\frac{3}{8}$ SM. Simultaneous approach authorized with Rwy 30R requires use of vertical guidance; maintain last assigned altitude until established on glideslope. Simultaneous approach authorized with Rwy 29. LOC only: Rwy 30L helicopter visibility reduction below RVR 4000 NA. *RVR 1800 authorized with use of FD or AP or HUD to DA.

MALSR



MISSED APPROACH: Climb to 2100 then climbing right turn to 3000 direct STL VORTAC and hold, continue climb-in-hold to 3000.

D-ATIS 125.025 379.925	ST. LOUIS APP CON 132.125 360.6	ST. LOUIS TOWER 118.5 257.7	GND CON 121.9 348.6 (Inbound) 121.65 377.175 (Outbound) 118.925 227.125 (Rwy 11/29)	CLNC DEL 119.5 363.1	CPDLC
--	---	---------------------------------------	---	--------------------------------	-------

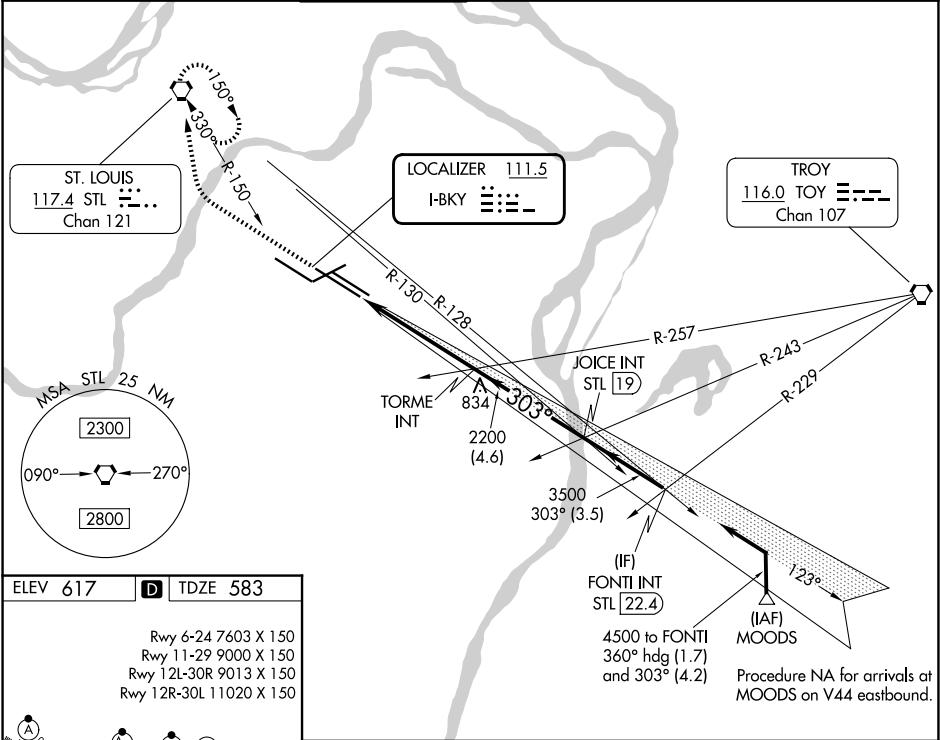

ELEV 617 **D** TDZE 583

Rwy 6-24 7603 X 150
Rwy 11-29 9000 X 150
Rwy 12L-30R 9013 X 150
Rwy 12R-30L 11020 X 150