


WAAS Ch 97323 W34A	APP CRS 345°	Rwy Ldg TDZE Apt Elev	11321 84 100
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 34

PORTSMOUTH INTL AT PEASE (PSM)

RNP APCH - GPS.		MALSR	MISSED APPROACH: Climb to 3300 direct ITAWA and hold, continue climb-in-hold to 3300
▼ ▲ Circling NA east of Rwy 16-34. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C. For inop ALS, increase LPV Cat E visibility to RVR 4000; increase LNAV/VNAV all Cats visibility to RVR 4500; increase LNAV Cat E visibility to 1 3⁄8 SM.			

ATIS 132.05 273.5	BOSTON APP CON 125.05 269.4	PORTSMOUTH TOWER 128.4 269.0	GND CON 120.95 275.8	CLNC DEL 335.8
-----------------------------	---------------------------------------	--	--------------------------------	--------------------------

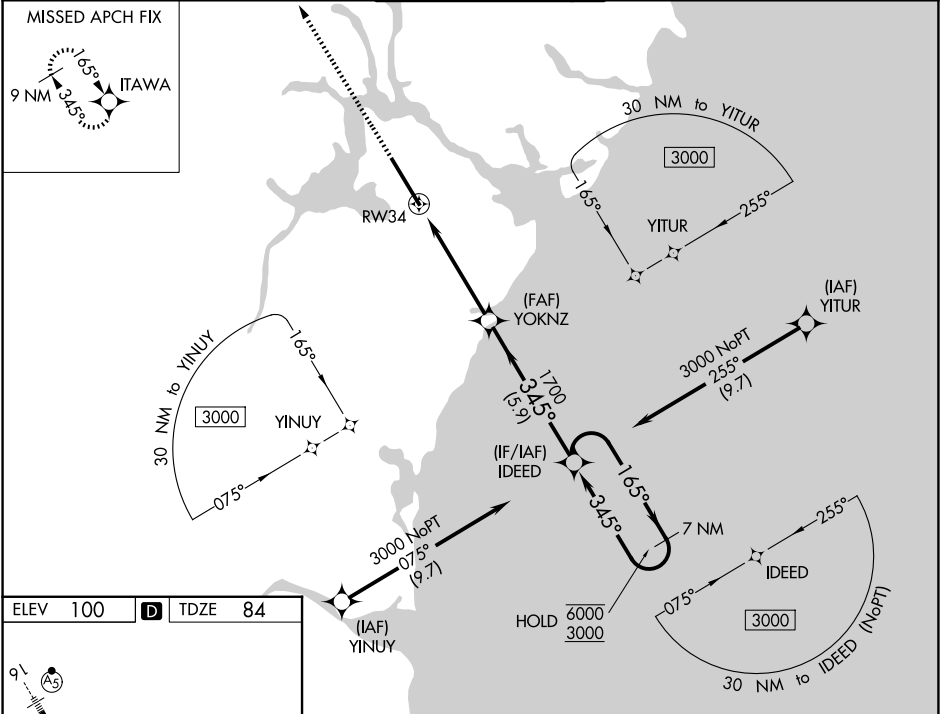

HIRL Rwy 16-34

3300

ITAWA

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00/TCH 80).

7 NM Holding Pattern

1.2 NM to RW34

1.2

3.7 NM

5.9 NM

IDEED

YOKNZ

1700

345°

165°

345°

1700

6000

3000

GP 3.00°

TCH 64

CATEGORY	A	B	C	D	E
LPV DA	284/24		200 (200-½)		
LNAV/VNAV DA	361/24		277 (300-½)		
LNAV MDA	540/24	456 (500-½)	540/45	456 (500-¾)	
CIRCLING	540-1 440 (500-1)	560-1 460 (500-1)	680-1½ 580 (600-1½)	780-2¼ 680 (700-2¼)	800-2½ 700 (700-2½)