


APP CRS 306°	Rwy Ldg TDZE Apt Elev	7614 57 62
------------------------	-----------------------------	---------------------------------------

RNAV (RNP) Z RWY 30L
NORMAN Y MINETA SAN JOSE INTL (SJC)

RNP AR APCH.  For uncompensated Baro-VNAV systems, procedure NA below 1°C or above 54°C. For inop ALS, increase RNP 0.10 all Cats visibility to RVR 5500 and increase RNP 0.30 all Cats visibility to 1½ SM.		MALS R 	MISSED APPROACH: Climb to 2000 on track 306° to ARTAQ and hold.	
D-ATIS 126.95	NORCAL APP CON 120.1 290.25	SAN JOSE TOWER ★ 124.0 (CTAF) 0 257.6	GND CON 121.7	UNICOM 122.95

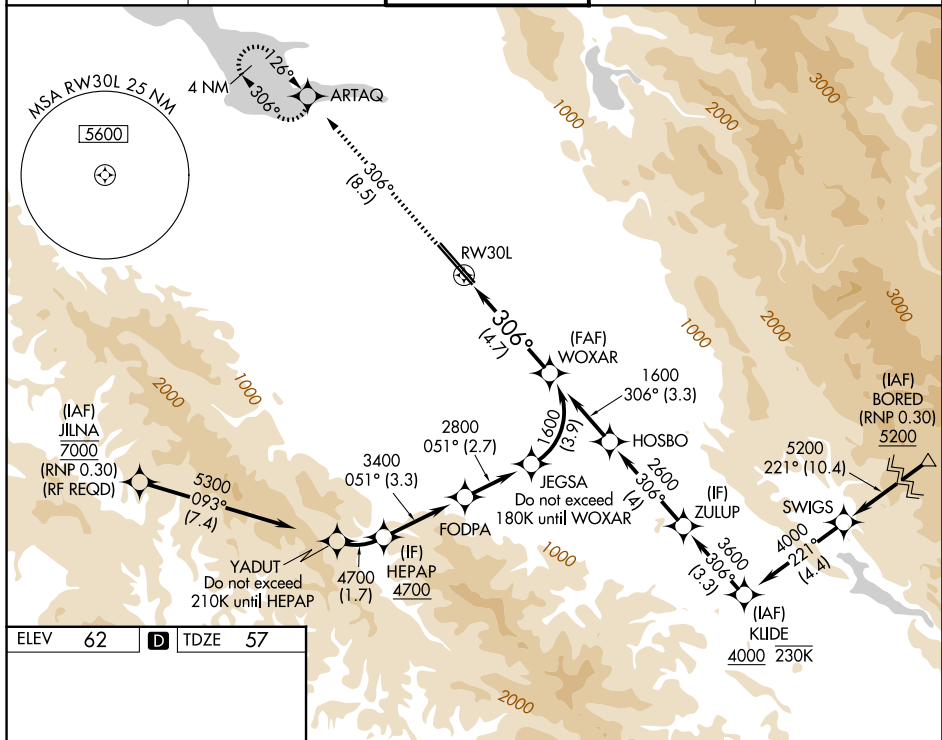

2000
↑
tr 306°

ARTAQ

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00°/TCH 70°).

WOXAR

1600

1600

306°

RW30L

4.7 NM

GP 3.00°
TCH 54

See planview for multiple IF locations.