


WAAS CH 78305 W10A	APP CRS 096°	Rwy Ldg TDZE 132 Apt Elev 142
--	------------------------	---

RNAV (GPS) RWY 10


LAKELAND LINDER INTL (LAL)

RNP APCH-GPS	ALSF-2	MISSED APPROACH: Climb to 1100 then climbing left turn to 2000 direct PLUMY and hold.
▼ ⚠ Circling NA to Rwy's 8 and 26. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cnts visibility to RVR 4500.		

ATIS 118.025	TAMPA APP CON 120.65 290.3	LAKELAND TOWER 124.5 236.775	GND CON 121.4
------------------------	--------------------------------------	--	-------------------------

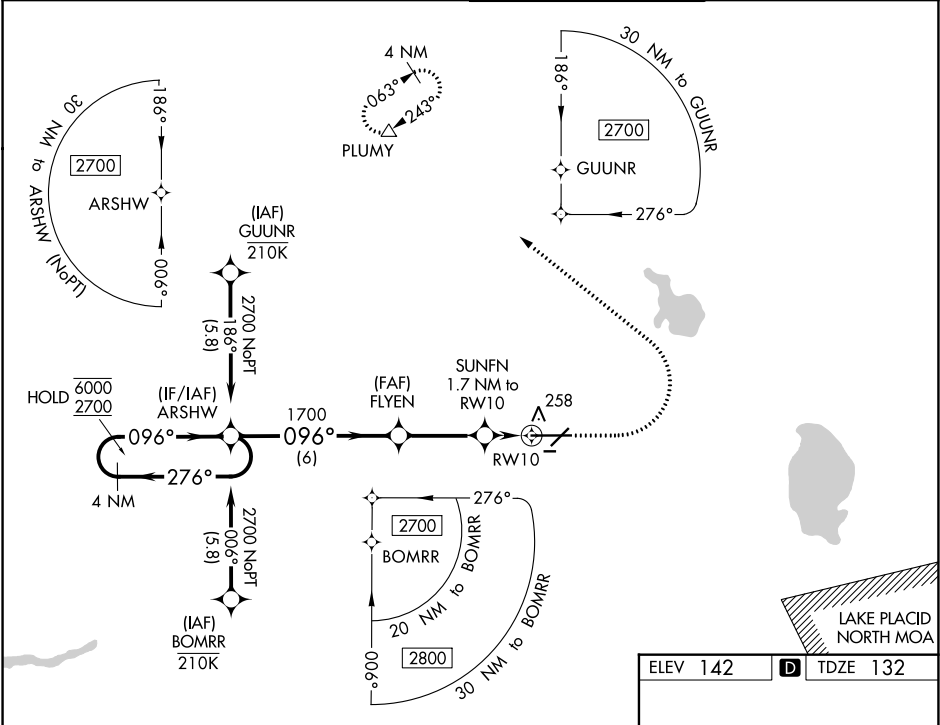

4 NM Holding Pattern		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 71).		1100 ↑	2000 ↙	PLUMY △
6000 ← 276° 2700 → 096°		ARSHW	FLYEN 1700	SUNFN 1.7 NM to RW10	1 NM to RW10	
GP 3.00° TCH 55		096°	1700	720	RW10	
		6 NM	3.1 NM	0.7 NM	1 NM	
CATEGORY	A	B	C	D		
LPV DA	332/18		200 (200-½)			
LNAV/ VNAV DA	439/24		307 (300-½)			
LNAV MDA	520/24	388 (400-½)		520/35	388 (400-¾)	
CIRCLING	600-1 458 (500-1)	660-1 518 (600-1)	720-1½ 578 (600-1½)	840-2¼ 698 (700-2¼)		

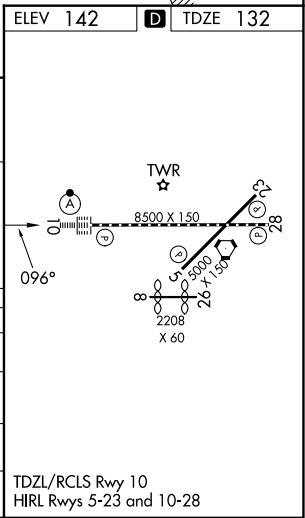

SE-3, 09 JUL 2026 to 06 AUG 2026

SE-3, 09 JUL 2026 to 06 AUG 2026