

YIGO, GUAM I, GUAM

TACAN Y RWY 24L

VORTAC UNZ 115.8 Chan 105	APCH CRS 236°	Rwy Idg 11,199 TDZE 607 Arpt Elev 617
---	-------------------------	--

(USAF)

ANDERSEN AFB (PGUA)

T * When ALS inop increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.
** Circling not authorized NW of Rwy 06L-24R.


SALS

MISSED APPROACH: Climb to 3000 direct CCOOK, then climbing left turn to intercept UNZ R-056 to DWAFF and hold.

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

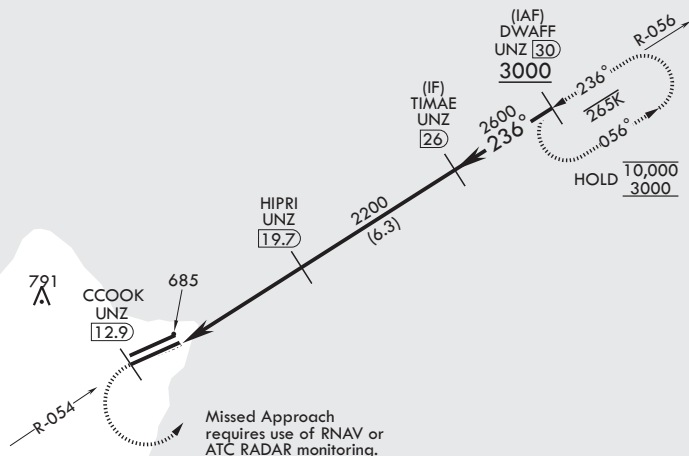


Missed Approach
requires use of RNAV or
ATC RADAR monitoring.

NIMITZ
115.8 UNZ
Chan 105

MSA UNZ 25 NM

2600

EMERG SAFE ALT 100 NM 2900

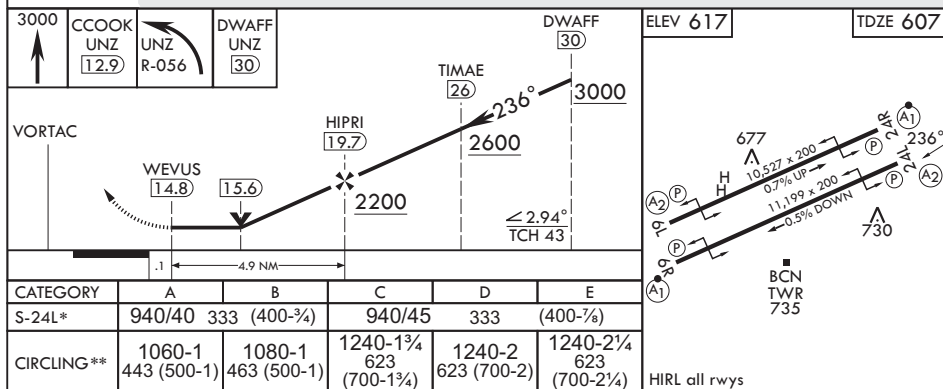

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 2 17JUN21
TERPS

TACAN Y RWY 24L

PAC, 09 JUL 2026 to 03 SEP 2026

PAC, 09 JUL 2026 to 03 SEP 2026